

5455 BRIGHTON BLVD

COMMERCE CITY CO 80022


PROPERTY TYPE
Commercial Office Building

YEAR BUILT
-

BUILDING AREA
6,310 SF

ROOF SQUARES
63

PARCEL ID
0182513201002

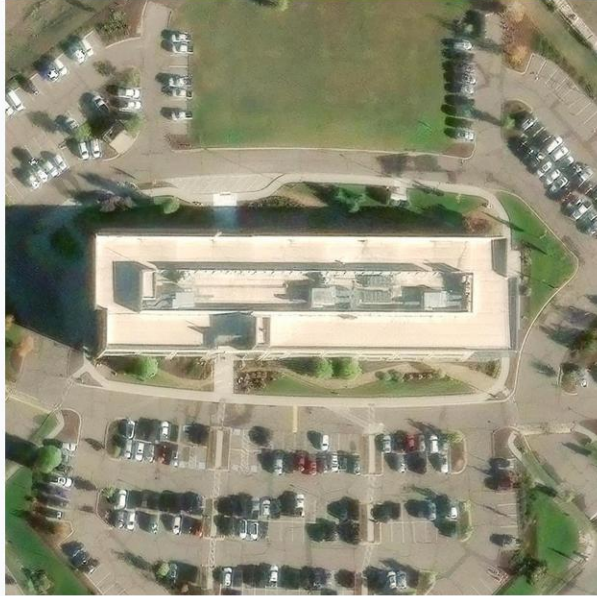

OVERALL ROOF CONDITION SCORE

74 /100
FAIR

RISK LEVEL

MODERATE



ROOF INFORMATION

ROOF TYPE	Low-slope commercial roof
ROOF SYSTEM	Single-ply membrane roof, likely white reflective membrane
POSSIBLE TYPES	TPO/PVC (74%); Coating over membrane (48%); Modified bitumen (22%)
VISIBLE CONCERNS	many penetrations/units; Central rooftop equipment creates multiple penetrations and flashing locations.; No clear ponding, major staining, or widespread discoloration visible in the roof field.
ROOF AGE EST.	Estimated moderate age; exact age not visible from aerial imagery.
ROOF AREA	6,310 SF
ROOF PITCH	Flat to very low slope
CONFIDENCE	76%

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY AS OF 09/06/2025

ROOF CONDITION BREAKDOWN

Membrane Condition		86/100
Ponding		88/100
Flashing & Seals		64/100
Penetrations		58/100
Overall Maintenance		80/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include high penetration or rooftop-unit density.
2. Roof appears broadly uniform and reflective with no obvious tears, open seams, or extensive patching visible at this altitude.
3. Several rooftop units/curbs and service areas are concentrated along the central spine of the roof, increasing flashing and seal complexity.
4. The roof surface does not show pronounced dark staining or obvious ponded water signatures in the visible image.
5. Perimeter vegetation is present nearby, but no tree contact or debris accumulation on the roof is clearly visible.

BUILDING CHARACTERISTICS

LAND AREA	1.56 acres
STORIES	-
CONSTRUCTION TYPE	-
TAX DISTRICT	-
LAND VALUE	-

REPORT SUMMARY

On the 09/06/2025 Esri aerial image, the roof presents as a generally well-kept low-slope commercial roof with a light-colored, uniform surface and no clear evidence of widespread staining or ponding. The main risk driver is the central cluster of rooftop equipment and associated penetrations, which increases flashing and leak potential. Overall visible condition appears good, though membrane type cannot be confirmed from aerial imagery alone. Visible risk factors include high penetration or rooftop-unit density.

Recommendation:

Maintain routine roof inspections and preventive maintenance, with particular attention to equipment curbs, seams, and penetrations around the central mechanical area. Continue to monitor for staining, sealant failures, or ponding after storms. A field inspection is recommended to confirm membrane type and verify the condition of flashings and rooftop units.

ROOF REPLACEMENT COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$165,085	Tear Off & Disposal	\$20,097
\$22.75 / SF	Roof Membrane	\$40,195
	Insulation	\$24,404
	Flashing/Edging	\$15,791
	Labor	\$43,066
	Replacement Subtotal	\$143,552
	Contingency (15%)	\$21,533
	Total Project Cost	\$165,085

This replacement cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.

ROOF OVERLAY COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$64,204	Overlay Subtotal	\$58,368
\$9.25 / SF	Contingency (10%)	\$5,837
	Total Project Cost	\$64,204

This overlay cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.