

13300 W 2ND PL

LAKEWOOD CO 80228


PROPERTY TYPE
Public School, Entire Elementary...

YEAR BUILT
1971

BUILDING AREA
42,222 SF

ROOF SQUARES
422

PARCEL ID
4907400006

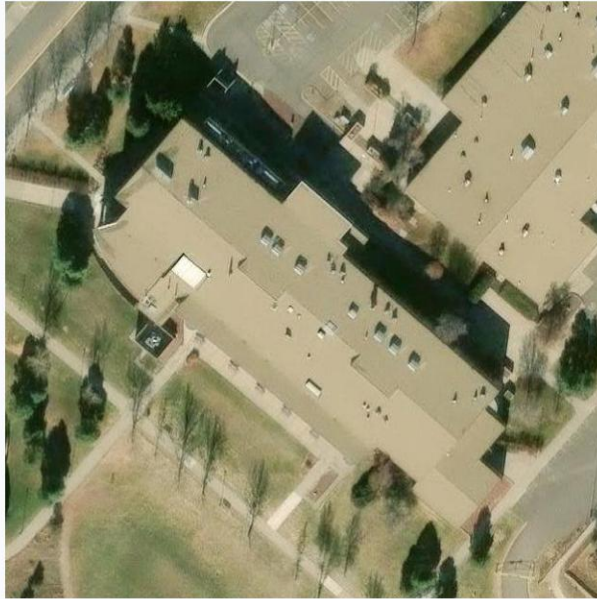

OVERALL ROOF CONDITION SCORE

62 /100
FAIR

RISK LEVEL

MODERATE



ROOF INFORMATION

ROOF TYPE	low-slope commercial roof
ROOF SYSTEM	single-ply membrane roof (exact chemistry not verifiable from aerial imagery)
POSSIBLE TYPES	TPO/PVC (48%); EPDM (30%); Modified bitumen (24%)
VISIBLE CONCERNS	dark staining/color variation; possible ponding; many penetrations/units; tree/debris exposure
ROOF AGE EST.	likely original or near-original roof era for a 1971-built school, but visible material appearance suggests later replacement may have occurred; exact age not verifiable from aerial imagery
ROOF AREA	42,222 SF
ROOF PITCH	low-slope / near-flat
CONFIDENCE	74%

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY

ROOF CONDITION BREAKDOWN

Membrane Condition		65/100
Ponding		55/100
Flashing & Seals		64/100
Penetrations		58/100
Overall Maintenance		61/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include dark staining or inconsistent roof color, possible ponding or drainage stress, high penetration or rooftop-unit density, tree overhang or roof debris exposure.
2. Large low-slope roof with multiple connected sections on a school campus.
3. Roof surface is generally light-colored and mostly uniform, but there are scattered darkened patches and tonal variation.
4. Numerous small vents/penetrations are visible across several roof areas.
5. Roof edges are bordered by mature trees and landscaped areas, with some overhanging proximity.

BUILDING CHARACTERISTICS

LAND AREA	89.41 acres
STORIES	1
CONSTRUCTION TYPE	Public
TAX DISTRICT	-
LAND VALUE	\$778,931

REPORT SUMMARY

Aerial imagery shows a large low-slope school roof that appears serviceable overall, with a generally uniform light-colored surface. Visible darkened areas, tonal irregularities, and the density of rooftop penetrations suggest moderate maintenance and leak-monitoring needs. Trees near the roof perimeter add debris and abrasion risk. Exact membrane chemistry cannot be confirmed from overhead imagery alone. Visible risk factors include dark staining or inconsistent roof color, possible ponding or drainage stress, high penetration or rooftop-unit density, tree overhang or roof debris exposure.

Recommendation:

Perform a close-up roof inspection to verify membrane type, check all penetrations and flashing terminations, and evaluate the darkened areas for recurring ponding, trapped moisture, or prior repairs. Trim back overhanging vegetation where needed and confirm drainage paths remain clear. Consider preventative maintenance and targeted repairs if the darkened areas correspond to chronic wet spots or seam/flashing distress. Field inspection should verify drainage, moisture, penetrations, flashing, and debris-related damage.

ROOF REPLACEMENT COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$1,189,605	Tear Off & Disposal	\$144,821
	Roof Membrane	\$289,643
	Insulation	\$175,855
	Flashing/Edging	\$113,788
	Labor	\$310,332
	Replacement Subtotal	\$1,034,439
	Contingency (15%)	\$155,166
	Total Project Cost	\$1,189,605

This replacement cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.

ROOF OVERLAY COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$452,831	Overlay Subtotal	\$411,664
	Contingency (10%)	\$41,166
	Total Project Cost	\$452,831

This overlay cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.