

13165 W OHIO AVE

LAKEWOOD CO 80228


PROPERTY TYPE
Public School, Entire Elementary...

YEAR BUILT
1971

BUILDING AREA
35,797 SF

ROOF SQUARES
358

PARCEL ID
4917300002

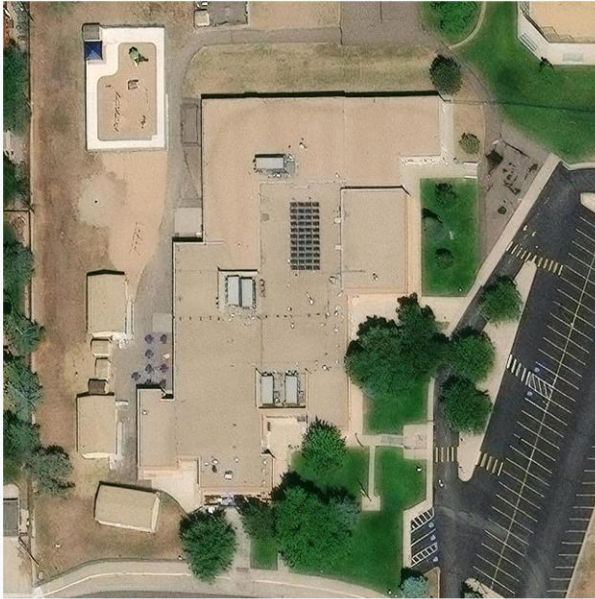

OVERALL ROOF CONDITION SCORE

64 /100
FAIR

RISK LEVEL

MODERATE



ROOF INFORMATION

ROOF TYPE	low-slope commercial roof
ROOF SYSTEM	likely single-ply membrane roof with multiple rooftop units/curbs
POSSIBLE TYPES	TPO/PVC (67%); EPDM (36%); coating over membrane (42%)
VISIBLE CONCERNS	dark staining/color variation; many penetrations/units; tree/debris exposure
ROOF AGE EST.	appears mid-life; exact age not determinable from aerial imagery alone
ROOF AREA	35,797 SF
ROOF PITCH	very low slope / near-flat
CONFIDENCE	73%

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY

ROOF CONDITION BREAKDOWN

Membrane Condition		62/100
Ponding		58/100
Flashing & Seals		60/100
Penetrations		55/100
Overall Maintenance		57/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density, tree overhang or roof debris exposure.
2. The roof is a large low-slope commercial roof with multiple stepped sections and several rooftop appurtenances.
3. Visible surface is generally uniform and serviceable, but there are scattered darker areas and seam/patch-like features that suggest prior maintenance or localized weathering.
4. Several mechanical units/curbs are present, especially near the roof center and lower-middle area.
5. Perimeter landscaping includes mature trees close to the building, with potential leaf litter and branch contact risk.

BUILDING CHARACTERISTICS

LAND AREA	10.51 acres
STORIES	1
CONSTRUCTION TYPE	Public
TAX DISTRICT	-
LAND VALUE	\$525,350

REPORT SUMMARY

This appears to be a low-slope commercial roof, most consistent with a single-ply membrane-type system or coated membrane, based on the light uniform roof surface and flat roof geometry. Visible condition is generally serviceable, but localized discoloration, multiple penetrations and rooftop units, and nearby trees add maintenance and leak-risk concerns. No major catastrophic defect is apparent from the aerial image, though the view is limited and cannot confirm membrane chemistry or hidden moisture issues. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density, tree overhang or roof debris exposure.

Recommendation:

Recommend a closer drone or roof-level inspection to verify membrane type, inspect seams and flashing at curbs and penetrations, and evaluate the darker stained areas for ponding history or repair needs. Trim back overhanging vegetation and confirm drainage paths are clear of debris. Field inspection should verify drainage, moisture, penetrations, flashing, and debris-related damage.

ROOF REPLACEMENT COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$1,008,580	Tear Off & Disposal	\$122,784
	Roof Membrane	\$245,567
	Insulation	\$149,095
	Flashing/Edging	\$96,473
	Labor	\$263,108
	Replacement Subtotal	\$877,026
	Contingency (15%)	\$131,554
	Total Project Cost	\$1,008,580

This replacement cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.

ROOF OVERLAY COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$383,923	Overlay Subtotal	\$349,021
	Contingency (10%)	\$34,902
	Total Project Cost	\$383,923

This overlay cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.