

12250 W KENTUCKY DR

LAKEWOOD CO 80228


PROPERTY TYPE
Public School, Entire Elementary...

YEAR BUILT
1962

BUILDING AREA
39,689 SF

ROOF SQUARES
397

PARCEL ID
4917423001

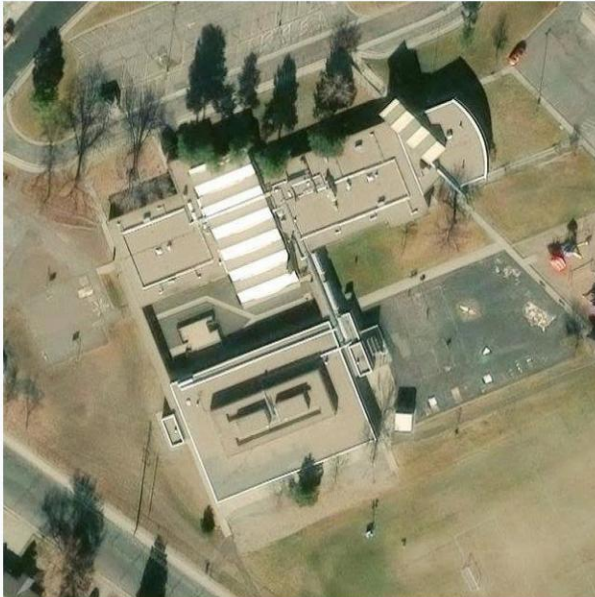

OVERALL ROOF CONDITION SCORE

58 /100
POOR

RISK LEVEL

HIGH



ROOF INFORMATION

ROOF TYPE	Mixed roof types
ROOF SYSTEM	Primary: TPO; Secondary: Metal
VISIBLE CONCERNS	dark staining/color variation; many penetrations/units; tree/debris exposure
ROOF AGE EST.	Likely older low-slope roof systems with visible weathering; exact installation age cannot be determined from aerial imagery. The 1962 construction date suggests a potentially long-service commercial school campus, but roof age may differ by section.
ROOF AREA	39,689 SF
ROOF PITCH	Predominantly low-slope/flat with one curved roof addition and minor raised transitions
CONFIDENCE	60%

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY

ROOF CONDITION BREAKDOWN

Membrane Condition		57/100
Ponding		54/100
Flashing & Seals		56/100
Penetrations		54/100
Overall Maintenance		58/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density, tree overhang or roof debris exposure.
2. Visible roof is mixed, with multiple low-slope zones separated by elevation changes and material transitions.
3. Upper-left and lower-center roof fields are light tan/cream and smooth-looking, but image softness prevents confirming TPO versus coated or weathered asphaltic material.
4. Right-lower roof field is darker and more uneven in tone, suggesting a separate weathered modified-bitumen/coated/membrane zone.
5. Upper-right curved addition shows rigid geometry and crisp edges consistent with metal roofing.

BUILDING CHARACTERISTICS

LAND AREA	9.57 acres
STORIES	1
CONSTRUCTION TYPE	Public
TAX DISTRICT	-
LAND VALUE	\$478,495

REPORT SUMMARY

Aerial imagery shows a mixed low-slope school roof with multiple distinct zones: broad light tan/cream membrane-like fields, a darker weathered roof section, and a small curved metal addition. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density, tree overhang or roof debris exposure.

Recommendation:

Overall condition appears fair with moderate serviceability risk based on visible weathering, discoloration, multiple penetrations, and a darker patchy roof section that could be more prone to leaks or moisture-related deterioration. Because the roof appears to be an older, apparently restorable low-slope assembly rather than asphalt shingles, a qualified commercial roof-coating contractor should inspect it onsite, perform moisture testing where warranted, confirm the existing system and warranty eligibility, identify required repairs and preparation, and provide a reliable project-price proposal. If the substrate is dry and sound and the existing system is compatible, evaluate silicone roof restoration before a more costly overlay or replacement, since a qualifying silicone system may reduce tear-off waste, cost, and disruption, create a seamless monolithic white reflective cool-roof surface, withstand ponding water when properly sized

ROOF REPAIR OPTIONS

Roof Replacement Cost Estimate

TOTAL PROJECT COST	COST SUMMARY
\$1,163,880	Replacement Subtotal \$1,012,070
\$25.50 / SF	Contingency (15%) \$151,810
	Total Project Cost \$1,163,880

Roof Overlay Cost Estimate

TOTAL PROJECT COST	COST SUMMARY
\$436,579	Overlay Subtotal \$396,890
\$10.00 / SF	Contingency (10%) \$39,689
	Total Project Cost \$436,579

Roof Coating Estimate

TOTAL PROJECT COST	WARRANTY TERM	BUDGETARY COST RANGE
\$138,912 - \$238,134	10 Year Warranty	\$138,912 - \$158,756
\$3.50 - \$6.00 / SF	15 Year Warranty	\$178,600 - \$198,445
	20 Year Warranty	\$218,290 - \$238,134

Cost estimates are derived from publicly available information and proprietary commercial roofing analysis models and are intended for preliminary budgeting and planning purposes only. Roof-area measurements do not include the vertical surface area of parapet walls. They should not be considered a contractor quote, engineering assessment, or guarantee of actual project costs. Estimates do not include additional repairs or unforeseen conditions that may be identified during an on-site inspection.