

## Trainings ▾


### Maintenance Check

#### Jacket

A minor buildup or streaking at the water pump weep hole (1) is normal. Do **not** repair or replace the water pump (2) unless an actual leak is confirmed. If a leak is confirmed, contact a Cummins® Authorized Repair Facility for replacement.

These engines can have a two pump, two loop, cooling system. The LTA pump will be located near the front gear train on the left bank, if equipped. Check both pumps. The procedure for both pumps is similar.

Inspect the water pump and bypass for coolant or oil leakage. Check the water pump weep hole for excessive leakage.

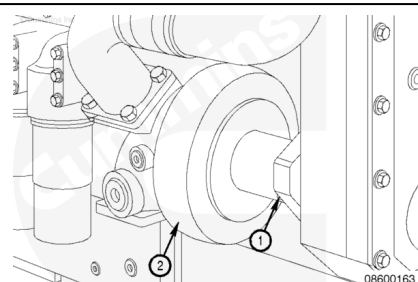


#### Dual Impeller

A minor chemical buildup or streaking at the water pump weep hole (1) is normal. Do **not** repair or replace the water pump unless an actual leak is confirmed. Contact a Cummins® Authorized Repair Location for replacement.

**Note :** Engines with a weep hole filter (2) installed may experience an occasional drip and minor chemical buildup at the filter. This is normal and does **not** indicate a leaking pump. Do **not** replace the water pump unless an actual leak is confirmed.


These engines have two pumping elements on a common shaft. There is **only** one weep hole.

Inspect the water pump and bypass for coolant or oil leakage. Check the water pump weep hole for excessive leakage.

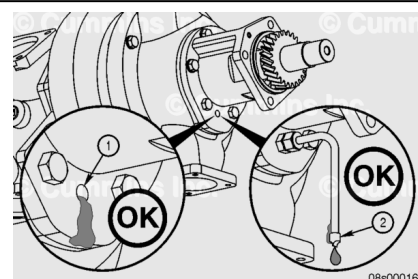

Check that the water pump weep hole filter is clean and free from any debris or chemical build-up.

Check the filter for cuts and tears.

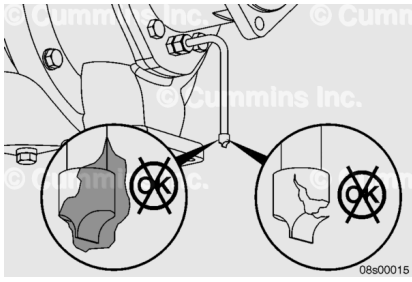

---

**Last Modified: 30-Oct-2023**

---