


Fault Code: 342-ECM2

Engine Control Module - Out of Calibration

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 342 PID(P): None SPN: FMI: 13 Lamp: Red SRT:	Engine Control Module - Out of Calibration. ECM calibrations do not match.	Engine will not start.

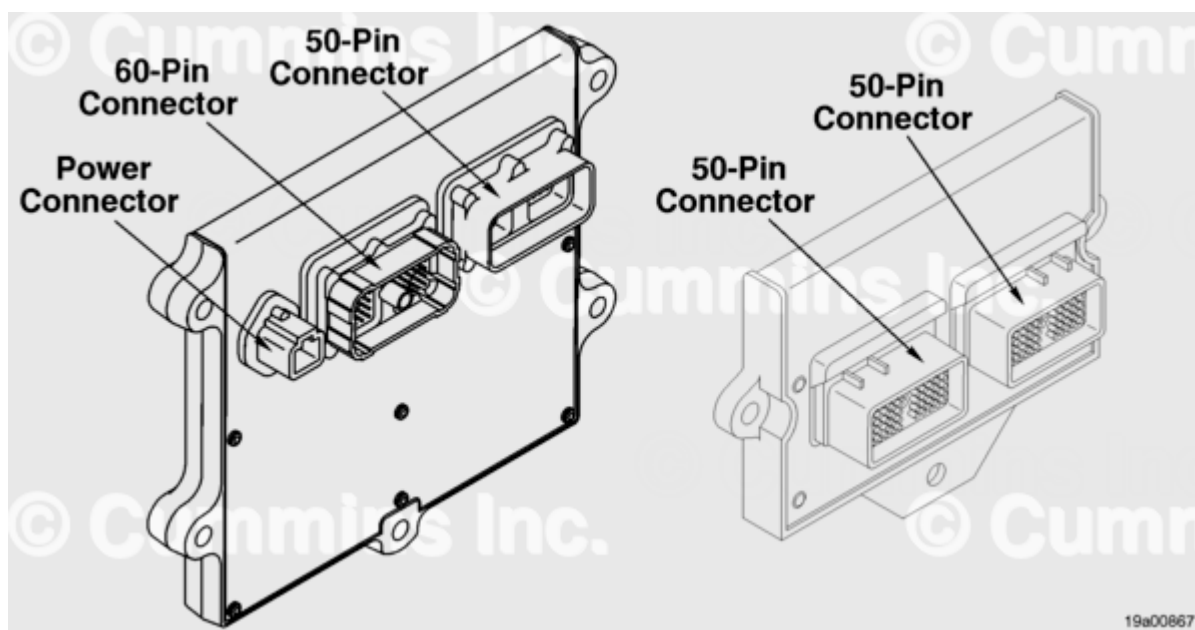

Electronic Control Module (ECM2)

Circuit Description

Fault Code 342 indicates the calibrations in the ECMs are **not** the same.

Component Location

ECM1, ECM2, and ECM3 are mounted above the flywheel housing on the rear of the engine. ECM1 is located (from left to right) on the left bank, followed by ECM2 in the middle, and ECM3 on the right bank. Refer to Procedure 100-002 in Section F.
(/qs3/pubsys2/xml/en/procedures/60/60-100-002.html)

Shoptalk

This problem can occur by changing a single ECM.

Refer to Troubleshooting Fault Code t05-342 (/qs3/pubsys2/xml/en/procedures/60/60-t05-342.html)

Last Modified: 20-Dec-2012
