


Fault Code: 148 (Industrial)

Frequency Throttle Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 148 PID(P): P091 SPN: 91 FMI: 8/8 Lamp: Red SRT:	A frequency of more than 100 Hz was detected at the frequency throttle signal pin of the actuator harness connector at the ECM.	Calibration-dependent power and speed derate.

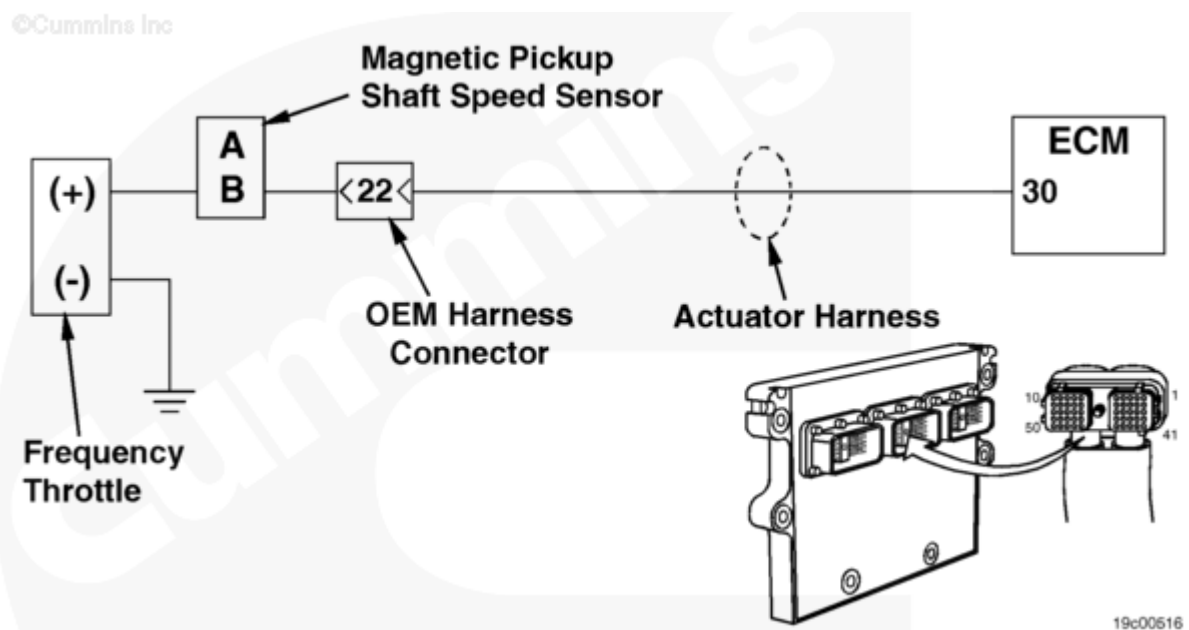

Frequency Throttle Circuit

Circuit Description

The frequency throttle provides the driver's throttle command to the electronic control module (ECM) through the OEM engine harness and the actuator harness. The ECM uses this signal to determine the fueling command.

Component Location

Throttle location varies with each OEM. Refer to the OEM troubleshooting and repair manual.

Shoptalk

The frequency throttle can be used either in conjunction with a voltage throttle or by itself.

Refer to Troubleshooting Fault Code t05-148 (</qs3/pubsys2/xml/en/procedures/82/82-t05-148.html>)

Last Modified: 02-Sep-2010
