


Fault Code: 2291

Vehicle Speed Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2291 PID(P): SPN: FMI: Lamp: Yellow SRT:	More than 0-mph vehicle speed detected when ICON™ is enabled.	The ICON™ system will be disabled. Only mandatory shutdown will be enabled.

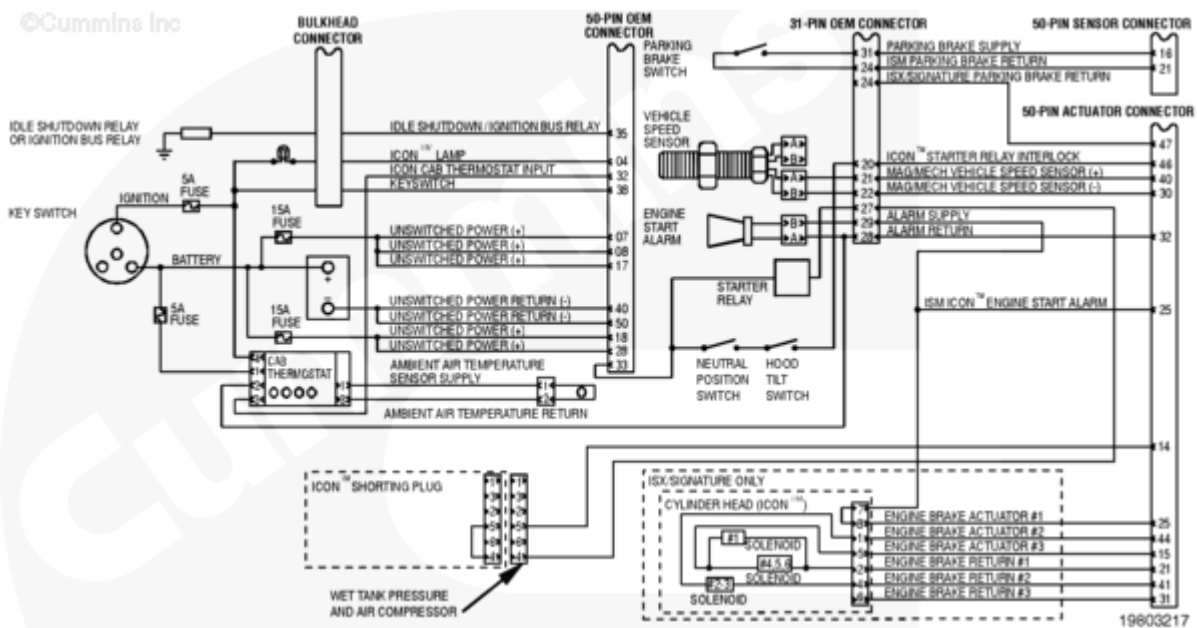

Integrated Idle ICON™ Circuit

Circuit Description

The ECM monitors vehicle speed when ICON™ is enabled for safety violation. The ECM reviews data through the magnetic pickup. This fault code indicates that vehicle speed has been detected.

Component Location

The vehicle speed sensor circuit is located on the vehicle transmission side.

Shoptalk

This fault indicates a vehicle speed greater than 0 mph when ICON™ is enabled. Typically, a loose or faulty ground will generate noise in the vehicle speed sensor circuit.

Refer to Troubleshooting Fault Code t05-2291 (</qs3/pubsys2/xml/en/procedures/82/82-t05-2291.html>)

Last Modified: 02-Sep-2010
