



Ambient Air Pressure Sensor



Overview

Codes	Reason	Effect
Fault Code: 295 PID(P): P108 SPN: 108 FMI: 2 Lamp: Yellow SRT:	An error in the ambient air pressure sensor signal was detected by the ECM.	Engine is derated to no air setting.

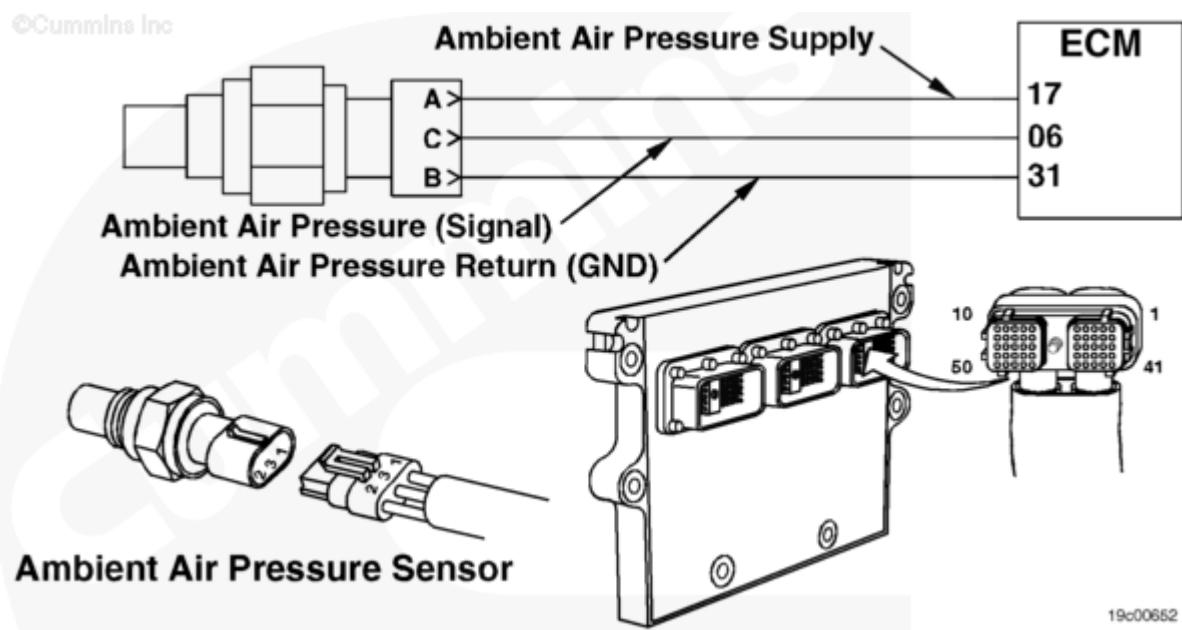

Ambient Air Pressure Sensor

Circuit Description

Component Location

The ambient air pressure sensor is located below the ECM.

Shoptalk

At key-on, the readings for ambient pressure from the ambient air pressure sensor, intake manifold pressure sensor, and oil pressure sensor are compared. This fault code occurs if the ambient air pressure sensor reading is different from the other two.

Refer to Troubleshooting Fault Code t05-295 (</qs3/pubsys2/xml/en/procedures/82/82-t05-295.html>)

Last Modified: 02-Sep-2010
