


Fault Code: 349

Auxiliary Speed Governor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 349 PID(P): P191 SPN: FMI: 0/16 Lamp: Yellow SRT:	A frequency greater than calibrated threshold was detected at the tailshaft governor signal pin of the 31-pin connector.	Calibration-dependent power and speed derate.

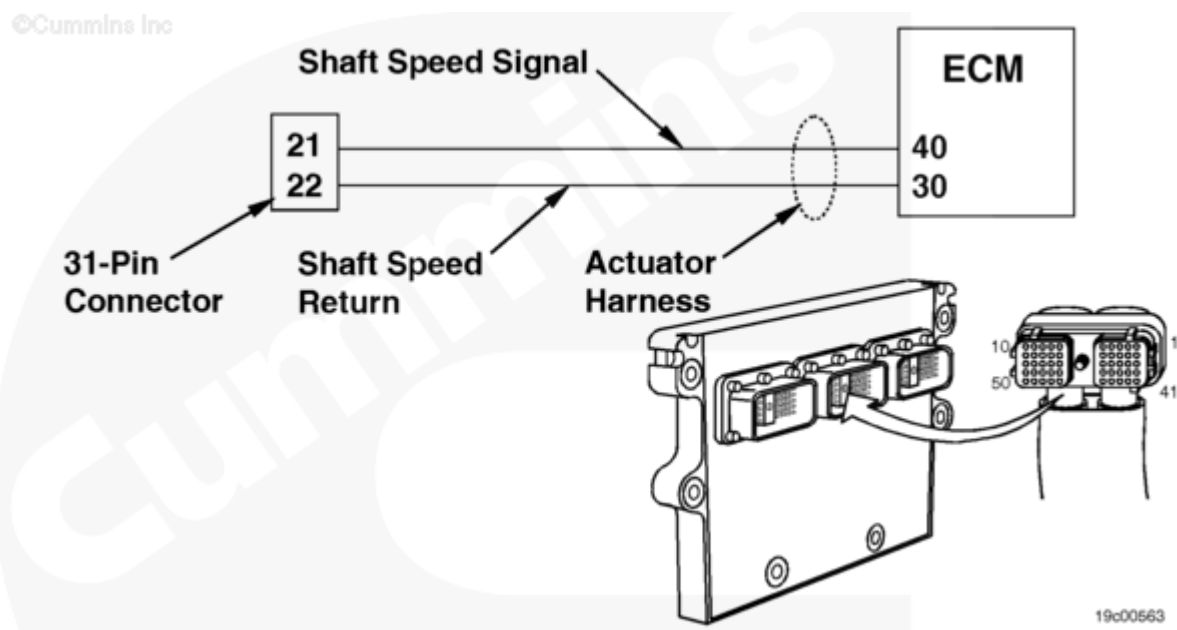

Auxiliary Speed Governor Circuit

Circuit Description

The auxiliary speed governor provides a means to govern the engine independent of engine speed. This circuit controls output shafts or other devices downstream of a torque converter.

The auxiliary speed governor provides a means to control the output shafts or other devices downstream of a torque converter, independent of engine speed.

Component Location

The auxiliary speed governor location varies with the OEM. Refer to the OEM troubleshooting and repair manual.

Shoptalk

This fault can **only** be caused by a high-frequency input into the auxiliary speed governor circuit.

Refer to Troubleshooting Fault Code t05-349 (</qs3/pubsys2/xml/en/procedures/82/82-t05-349.html>)

Last Modified: 02-Sep-2010
