


Fault Code: 489 (INDUSTRIAL)

Auxiliary Speed Input Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 489 PID(P): P191 SPN: 191 FMI: 1/18 Lamp: Yellow SRT:	Auxiliary speed frequency on input pin indicates the frequency is below a calibration-dependent threshold.	Engine will only idle.

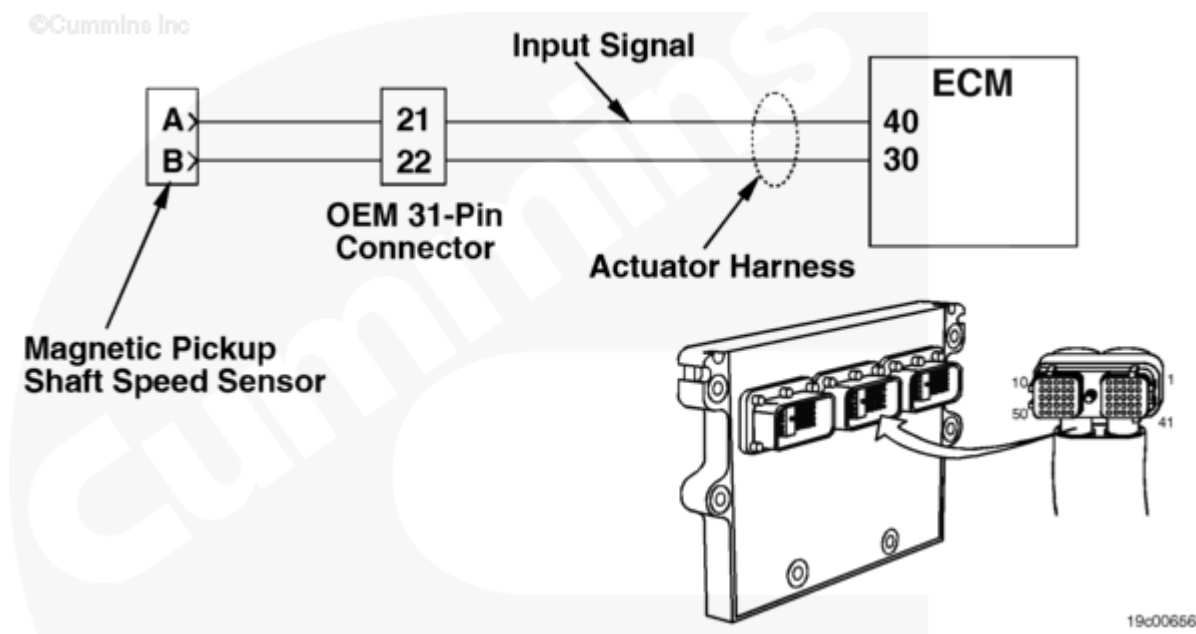

Auxiliary Speed Input Circuit

Circuit Description

The auxiliary speed input is a frequency signal from an auxiliary speed or pressure pickup. It is sent to the electronic control module (ECM) and is used to control the engine speed. Auxiliary reference speed is based on the throttle position.

Component Location

The auxiliary speed or pressure pickup device location is dependent on the OEM application. Refer to the OEM troubleshooting and repair manual for component location.

Shoptalk

The auxiliary speed governor controls engine speed based on a measured auxiliary speed or pressure.

Refer to Troubleshooting Fault Code t05-489 (</qs3/pubsys2/xml/en/procedures/82/82-t05-489.html>)

Last Modified: 02-Sep-2010
