


Fault Code: 538

Autoshift Neutral Actuator

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 538 PID(P): S045 SPN: 719 FMI: 11/11 Lamp: Yellow SRT:	Either low voltage detected on autoshift neutral gear actuator circuit when + 12 VDC are commanded or voltage detected when no voltage is commanded.	Top 2 neutral actuator will not function properly. Transmission will not shift properly.

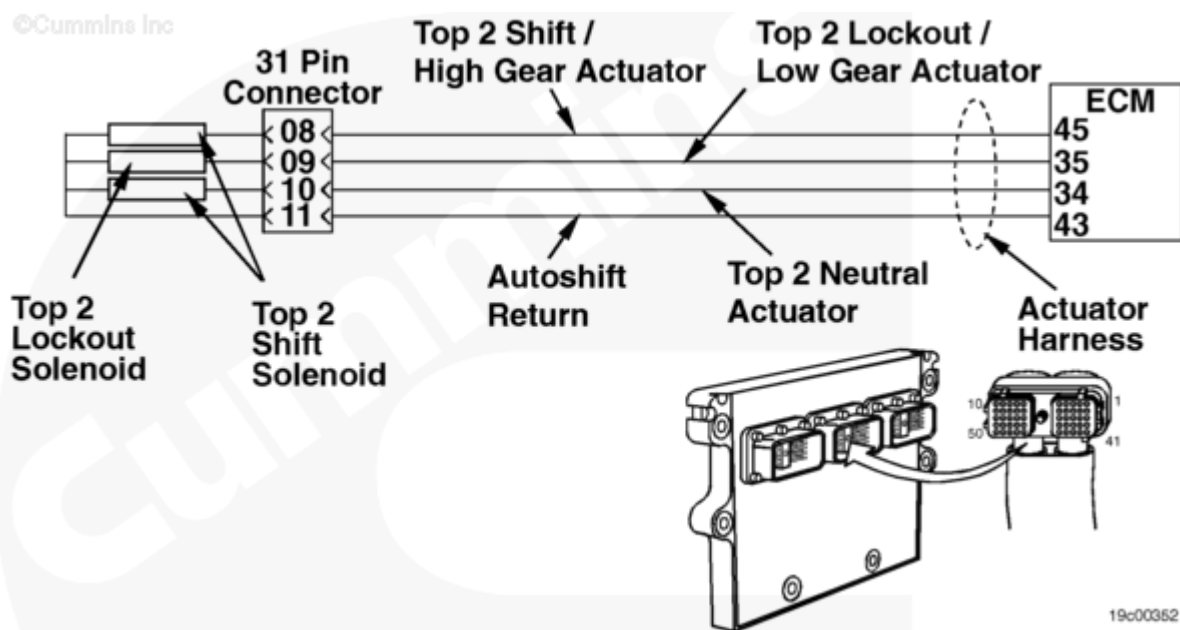

Top 2 Shift Solenoid Circuit

Circuit Description

The autoshift neutral actuator is an ECM-driven solenoid that controls a Top 2 transmission.

Component Location

The autoshift neutral actuator is located on the topside of the transmission toward the back. Refer to an OEM diagram for the specific location.

Refer to Troubleshooting Fault Code t05-538 (/qs3/pubsys2/xml/en/procedures/82/82-t05-538.html)

Last Modified: 02-Sep-2010
