


Fault Code: 541

ICON™ Starter Relay Input Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 541 PID(P): S123 SPN: 615 FMI: 11/31 Lamp: Yellow SRT:	Incorrect voltage detected at the ICON™ starter relay input circuit by the ECM.	The ICON™ system will be disabled. Mandatory shutdown can still be enabled. Engine can be started normally.

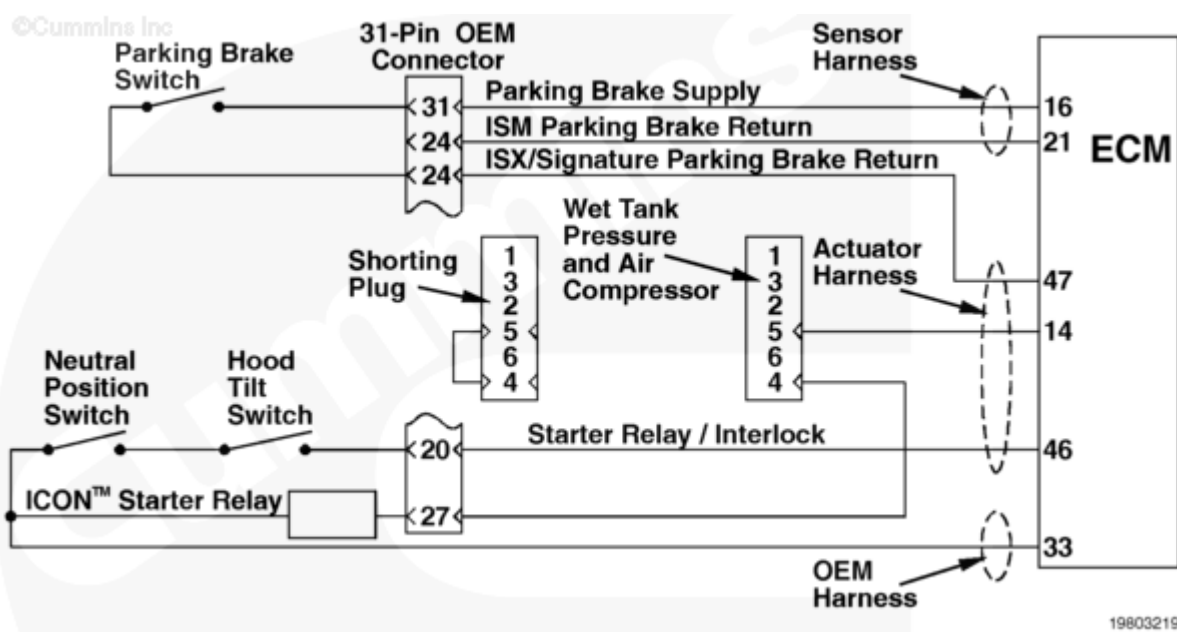

ICON™ Starter Relay/Interlock Circuit

Circuit Description

Incorrect voltage detected at the ICON™ starter relay circuit by the ECM.

Component Location

The ICON™ starter relay is located on the vehicle-side fire wall near the vehicle starter relay.

Shoptalk

This fault indicates a short circuit to battery/ground or an open ICON™ starter relay circuit. All interlock switches **must** be closed and the ICON™ lamp **must** be functional before the ICON™ system can be enabled for the engine to run while ICON™ is active. These circuits apply **only** when ICON™ is enabled.

Refer to Troubleshooting Fault Code t05-541 (</qs3/pubsys2/xml/en/procedures/82/82-t05-541.html>)

Last Modified: 02-Sep-2010
