


Fault Code: 544

Top 2 Transmission Circuit - Mechanical System Failure

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 544 PID(P): S151 SPN: 611 FMI: 7/7 Lamp: Yellow SRT:	Autoshift failure; at least three shift attempts were missed.	Top 2 transmission will not be controlled correctly. Transmission remains in manual mode.

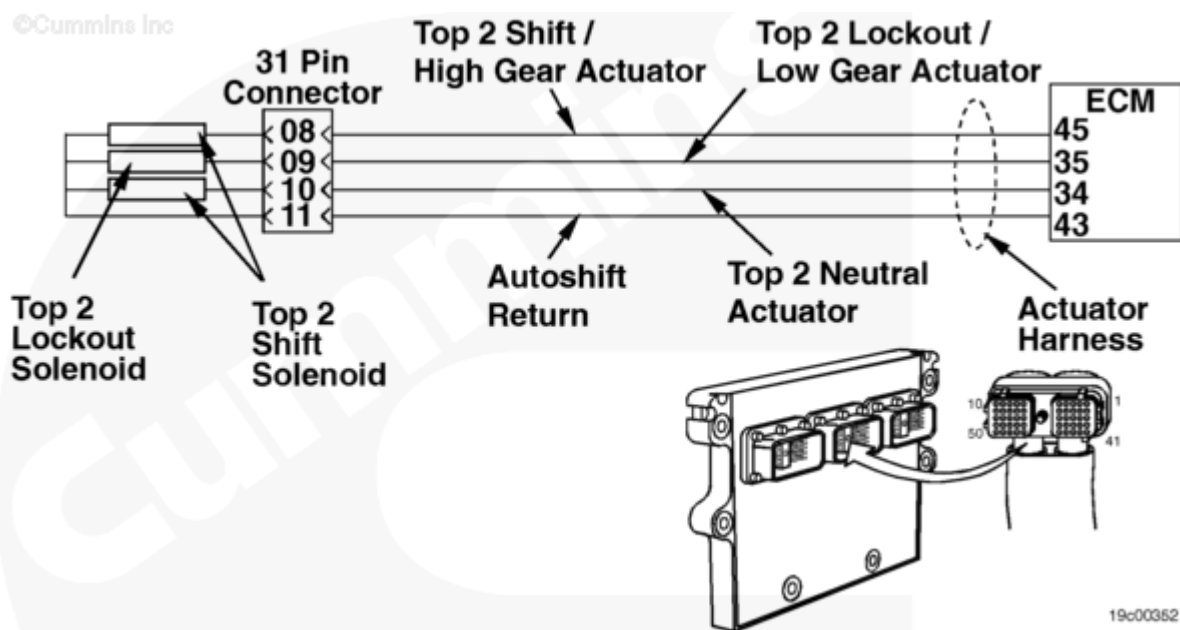

Top 2 Transmission Circuit

Circuit Description

The Top 2 transmission circuit controls a Top 2 transmission to autoshift between the Top 2 gears.

Component Location

The Top 2 shift/lockout solenoids are on the topside of the transmission, near the back. Refer to an OEM diagram for the exact location.

Refer to Troubleshooting Fault Code t05-544 (</qs3/pubsys2/xml/en/procedures/82/82-t05-544.html>)

Last Modified: 02-Sep-2010
