


Fault Code: 581

Fuel Inlet Restriction Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 581 PID(P): P015 SPN: 1381 FMI: 3/3 Lamp: Yellow SRT:	High voltage detected on fuel inlet restriction sensor signal pin.	Fuel inlet restriction monitor deactivated.

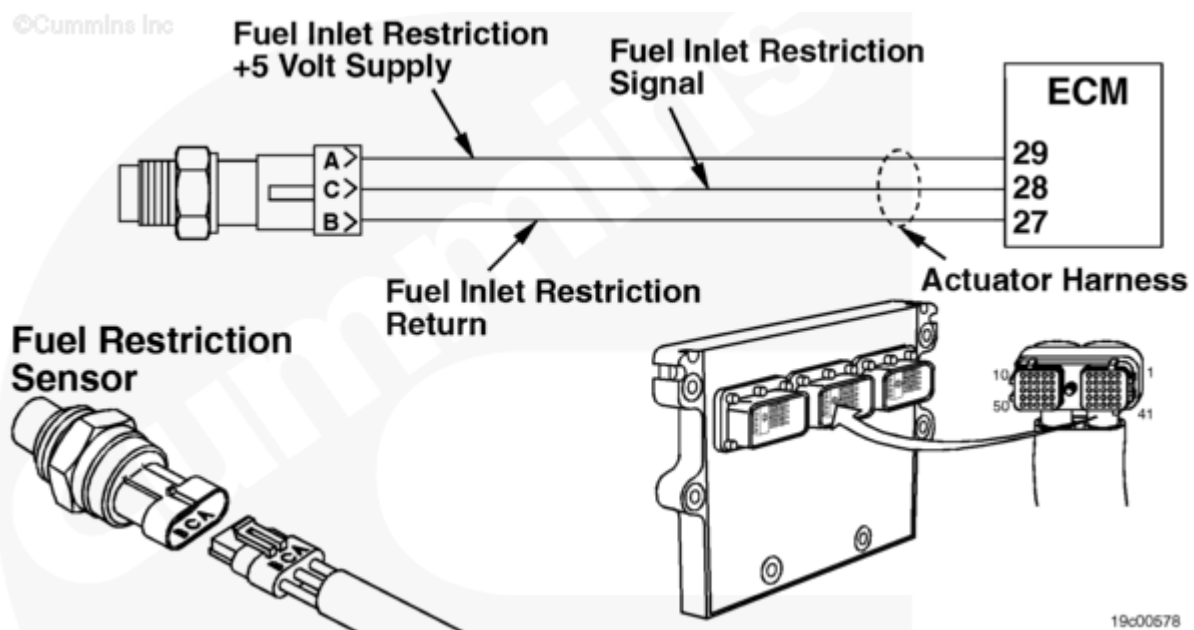

Fuel Inlet Restriction Sensor Circuit

Circuit Description

The fuel inlet restriction sensor provides a fuel pressure signal to the electronic control module (ECM).

Component Location

The fuel inlet restriction sensor is located on the fuel filter head.

Shoptalk

This fault indicates that a short circuit of at least positive + 5 VDC has occurred at signal pin 28 on the actuator harness connector at the ECM.

Refer to Troubleshooting Fault Code t05-581 (</qs3/pubsys2/xml/en/procedures/82/82-t05-581.html>)

Last Modified: 02-Sep-2010
