


Fault Code: 583

Fuel Inlet Restriction Sensor Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 583 PID(P): P015 SPN: 1381 FMI: 1/18 Lamp: Yellow SRT:	Restriction has been detected by the fuel inlet restriction sensor.	Fuel inlet restriction monitor warning is set.

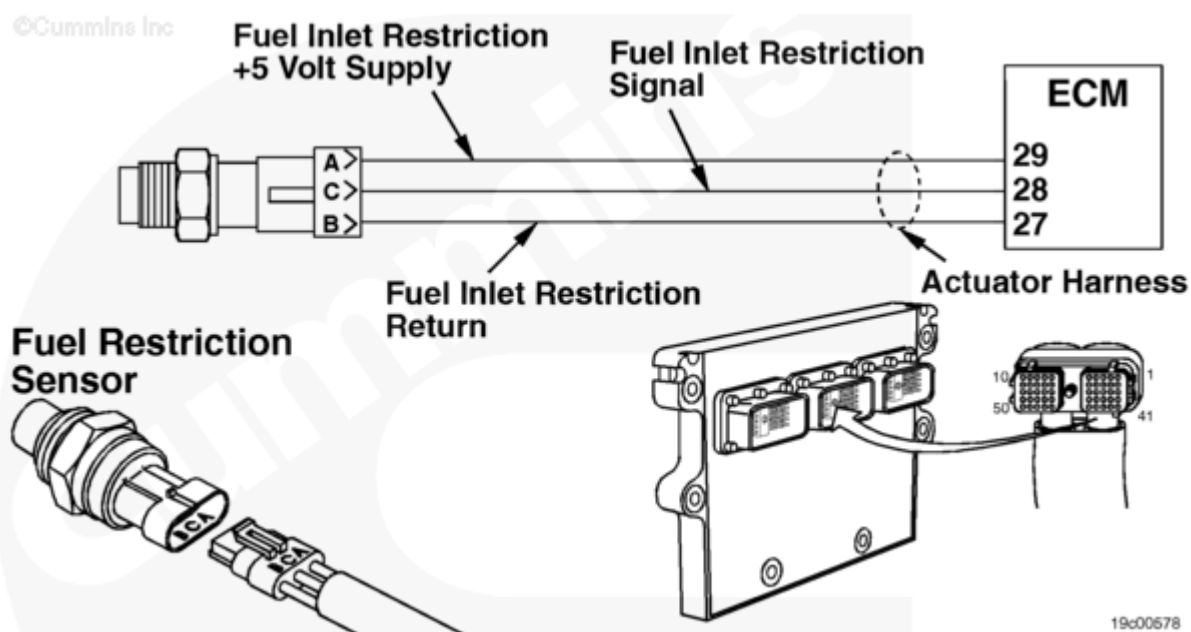

Fuel Inlet Restriction Sensor Circuit

Circuit Description

The fuel inlet restriction sensor provides a signal to the electronic control module (ECM).

Component Location

The fuel inlet restriction sensor is located on the inlet to the fuel filter head.

Shoptalk

This fault indicates that the fuel inlet restriction has exceeded 12 in Hg. Typical causes for this fault code include a plugged fuel filter and a collapsed fuel supply hose.

Refer to Troubleshooting Fault Code t05-583 (</qs3/pubsys2/xml/en/procedures/82/82-t05-583.html>)

Last Modified: 02-Sep-2010
