


Fault Code: 588

ICON™ Starter Relay Input Circuit

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 588 PID(P): S121 SPN: 611 FMI: 3/3 Lamp: Yellow SRT:	High voltage detected at the alarm circuit when low voltage was expected by the ECM.	The ICON™ system will be disabled. Only mandatory shutdown will be enabled. Engine can be started normally.

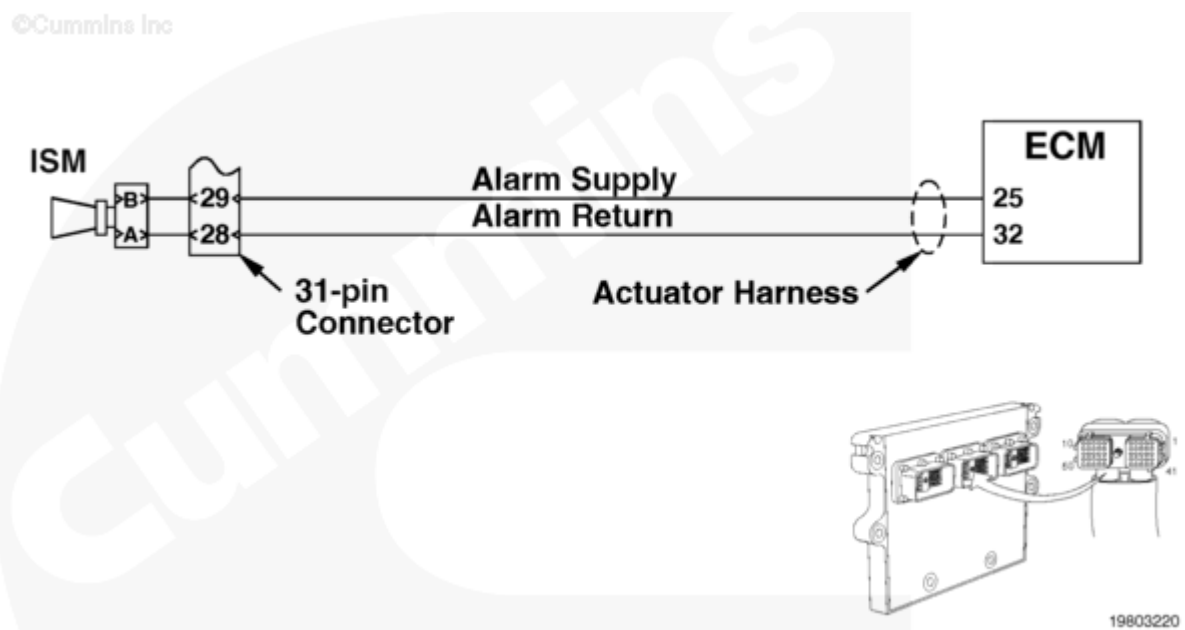

Engine Start Alarm Circuit

Circuit Description

The alarm circuit turns on the audible alarm to warn of an impending engine start.

Component Location

The ICON™ alarm is mounted on the vehicle's fire wall on the intake side of the engine.

Shoptalk

This fault typically indicates short circuit to battery or an open circuit. The fan 2 clutch feature is **not** used.

Refer to Troubleshooting Fault Code t05-588 (</qs3/pubsys2/xml/en/procedures/82/82-t05-588.html>)

Last Modified: 02-Sep-2010
