

Fault Code: 111


Electronic Control Module Microprocessor

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 111 PID(P): S254 SPN: 629 FMI: 12 Lamp: Red SRT:	Error internal to the ECM, related to the memory hardware failures or internal microprocessor communication failures.	Engine will not start.

©Cummins Inc

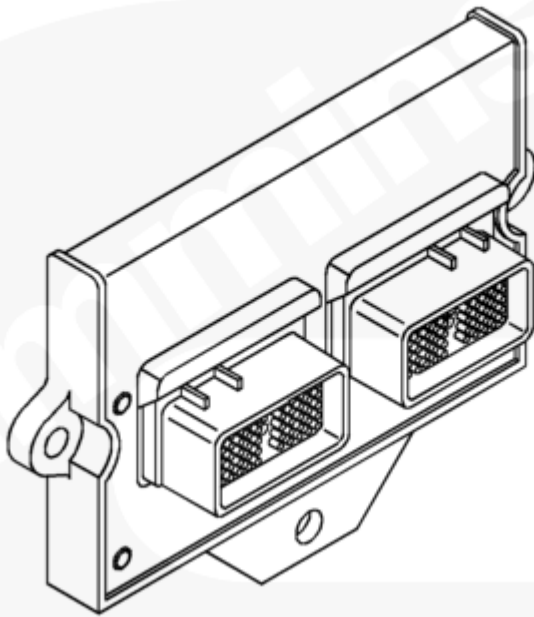

19900397

ECM

Circuit Description

The CM 552 ECM is a computer that is responsible for engine control, diagnostics, and user features.

Component Location

Two ECMs are on board the QST30 engine, one on each side, in front of the fuel pumps.

Shoptalk

This fault code can **only** be caused by an internal ECM problem. There are no repairs possible for the module in the field.

Refer to Troubleshooting Fault Code t05-111 (</qs3/pubsys2/xml/en/procedures/87/87-t05-111.html>)

Last Modified: 29-Jul-2010
