


Fault Code: 172

Fuel Control Rack Stuck

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 172 PID(P): S023 SPN: 638 FMI: 7 Lamp: Red SRT:	Fuel control rack is stuck in a position commanding excessive fueling to the engine.	Engine shutdown.

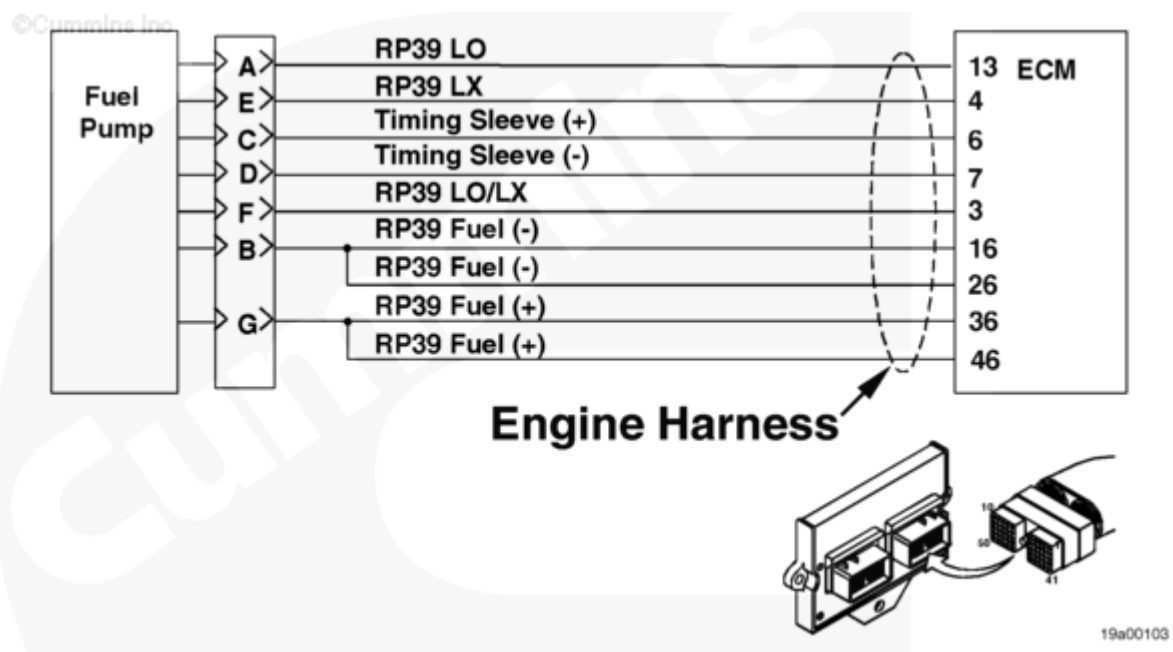

Rack Actuator Circuit

Circuit Description

The fuel control rack and solenoid determine the quantity of fuel metered to the engine.

Component Location

The fuel control rack and solenoid are integral parts of the RP39 fuel pump.

Shoptalk

- Confirm that the actuator connector is firmly in place.

Refer to Troubleshooting Fault Code t05-172 (</qs3/pubsys2/xml/en/procedures/87/87-t05-172.html>)

Last Modified: 19-Feb-2018
