


Fault Code: 185

Primary Electronic Control Module/Secondary Electronic Control Module (ECM) Communication

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 185 PID(P): 231 SPN: 639 FMI: 2 Lamp: Yellow SRT:	Communication between the primary electronic control module (ECM) and secondary ECM has been interrupted.	Engine can only run on the left or right bank. Possible loss of performance.

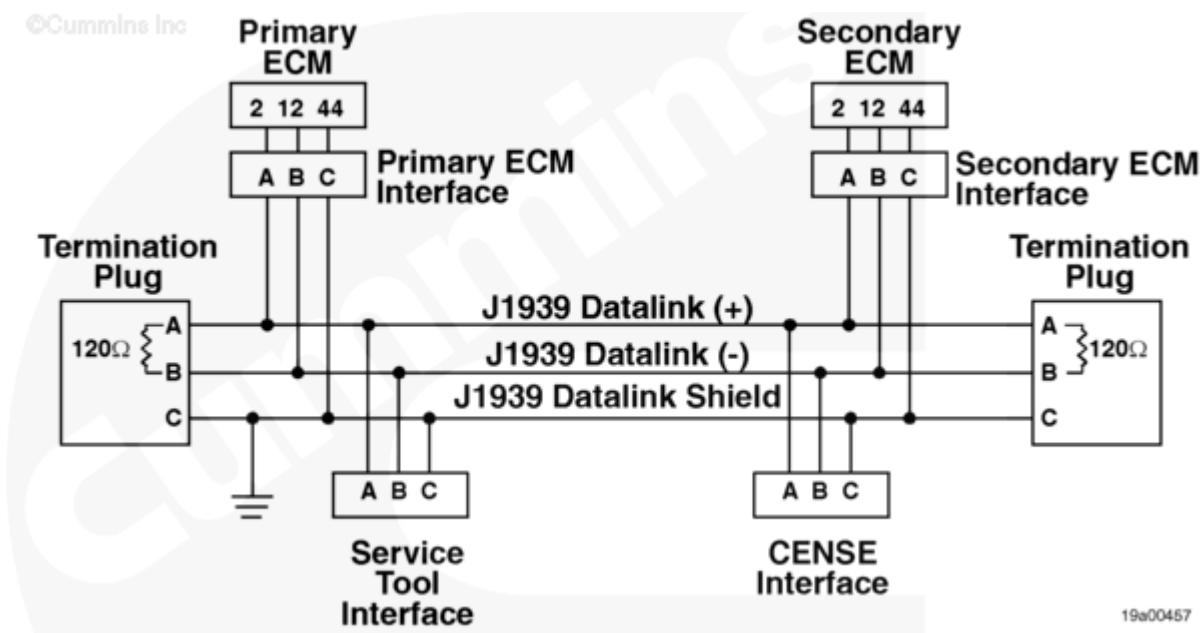

J1939 Backbone Harness Circuit Diagram

Circuit Description

The QST30 electronic control system utilizes an SAE J1939 backbone harness for communication between the primary and secondary ECMs. If this backbone fails, communication between the ECMs will stop, causing the engine to run poorly.

Component Location

The primary ECM is located on the left bank of the engine, in front of the fuel pump. The secondary ECM is located on the right bank of the engine. The SAE J1939 backbone harness is a separate, three-wire harness located on the engine.

Shoptalk

The secondary ECM receives its fueling and timing commands from the primary ECM.

Refer to Troubleshooting Fault Code t05-185 (</qs3/pubsys2/xml/en/procedures/87/87-t05-185.html>)

Last Modified: 27-Jul-2016
