

Fault Code: 342


Calibration Match Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 342 PID(P): S253 SPN: 630 FMI: 13 Lamp: Red SRT:	The primary and secondary ECM calibrations do not match.	The engine will not start.

©Cummins Inc

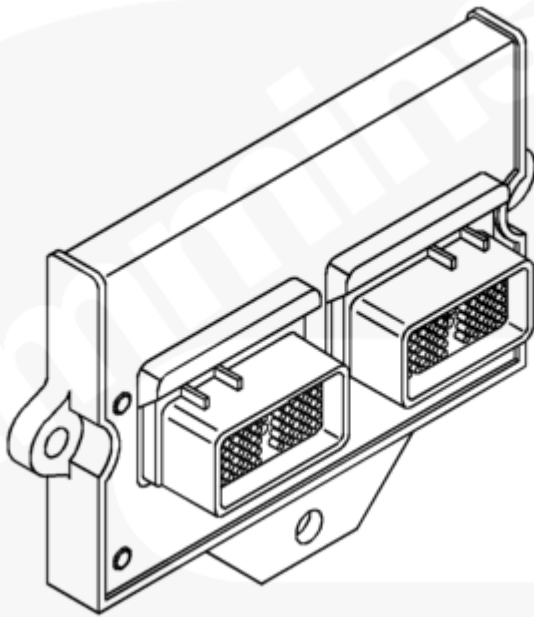

19900397

Electronic Control Module (ECM)

Circuit Description

Fault Code 342 indicates that the calibrations in the primary and secondary ECMs are **not** the same.

Component Location

Two ECMs are aboard the QST30 engine, one on each side.

Shoptalk

This fault code can occur by changing or calibrating a single ECM. Single module calibration is **not** supported by INSITE™ electronic service tool for CM552 modules on QST30 Industrial engines. Both modules **must** be calibrated together. Refer to Procedure 019-032 in Section 19. (</qs3/pubsys2/xml/en/procedures/87/87-019-032.html>)

Refer to Troubleshooting Fault Code t05-342. (</qs3/pubsys2/xml/en/procedures/87/87-t05-342.html>)

Last Modified: 18-Mar-2011
