

Fault Code: 327


Fuel Rate - Out of Range High

 Printable Version


Overview

Codes	Reason	Effect
Fault Code: 327 PID(P): SPN: FMI: Lamp: Red SRT:	Fuel Rate - Out of Range High. The Centinel™ control module detected a fuel rate out of range high signal from the electronic control module (ECM).	The Centinel™ system will not operate properly.

©Cummins Inc

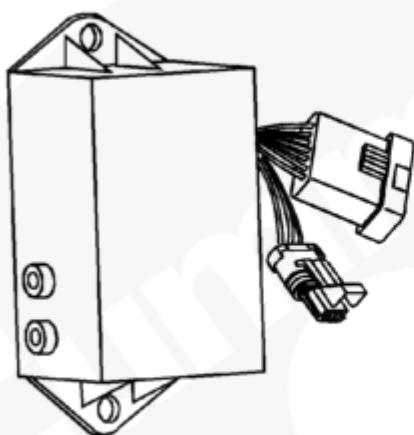

HD

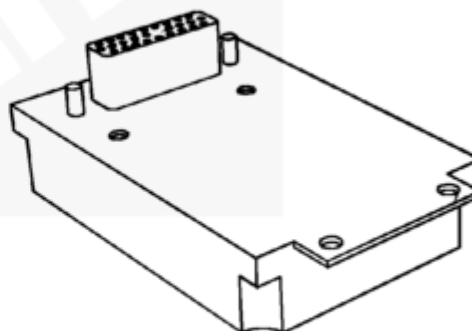

HHP

05800058

Circuit Description

The Centinel™ control module monitors the engine dynamics via information from the electronic control module (ECM). If the fuel rate is out of range, the Centinel™ control module will display a fault.

Component Location

Heavy-Duty: The Centinel™ control module is located on the Centinel™ system make-up oil tank.

High-Horsepower: The Centinel™ control module is located on the Centinel™ system oil control valve mounting bracket.

Troubleshooting Summary

STEPS		SPECIFICATIONS
STEP 1.	Check the fault codes.	
	STEP 1A. Read the fault codes.	Fuel rate data OK
STEP 2.	Clear the fault code.	
	STEP 2A. Disable the fault code.	Fault Code 327 inactive

STEP 1. Check the fault codes.

STEP 1A. Check for active fault codes.

Conditions :

- Turn the keyswitch ON.

Action	Specification/Repair	Next Step
• Verify ECM fuel rate data using INSITE™ electronic service tool.	Fuel rate data OK	2A
	Reprogram the ECM Refer to Procedure 019-032 (/qs3/pubsys2/xml/en/procedures/105/105-019-032.html) and the INSITE™ user manual.	2A

STEP 2. Clear the fault code.

STEP 2A. Disable the fault code.

Conditions :

- Connect all components.

Action	Specification/Repair	Next Step
--------	----------------------	-----------

• Connect all the components. • Start the engine and let it idle for 1 minute. • Verify Fault Code 327 is inactive.	Fault Code 327 inactive	Complete
	Return to the troubleshooting step or contact your local Cummins Authorized Repair Location if all the steps have been completed and checked again.	1A

Last Modified: 25-Feb-2004
