



Service Bulletin Number: 4021468

Released Date: 01-aug-2003

Articulated Piston Skirt Reuse Guidelines for Signature, ISX, and QSX15 Engines

Articulated Piston Skirt Reuse Guidelines for Signature, ISX, and QSX15 Engines

General Information

This bulletin applies inspection criteria for piston skirts on Signature, ISX, and QSX15 engines. Cummins Distributors and Dealers are encouraged to consult these guidelines when seeking to determine if used articulated piston skirts are acceptable for reuse.


Piston skirts for articulated pistons are now available independent of the piston crowns. Crown reuse guidelines are outlined in Procedure Refer to Procedure 001-043 (</qs3/pubsys2/xml/en/procedures/10/10-001-043.html>) of the Troubleshooting and Repair Manual, Signature, ISX and QSX15 Engines, Bulletin 3666239.

Cylinder Liner Inspection - Inspect, and replace as necessary, all cylinder liners that do **not** meet the reuse guidelines as detailed in the Parts Reuse Guidelines manual, Bulletin 3810303.

Reuse Guidelines

The digital photographs on this page depict piston skirts that are acceptable for reuse. The scratches are **not** deep and can **not** be felt with a fingernail.

©Cummins Inc

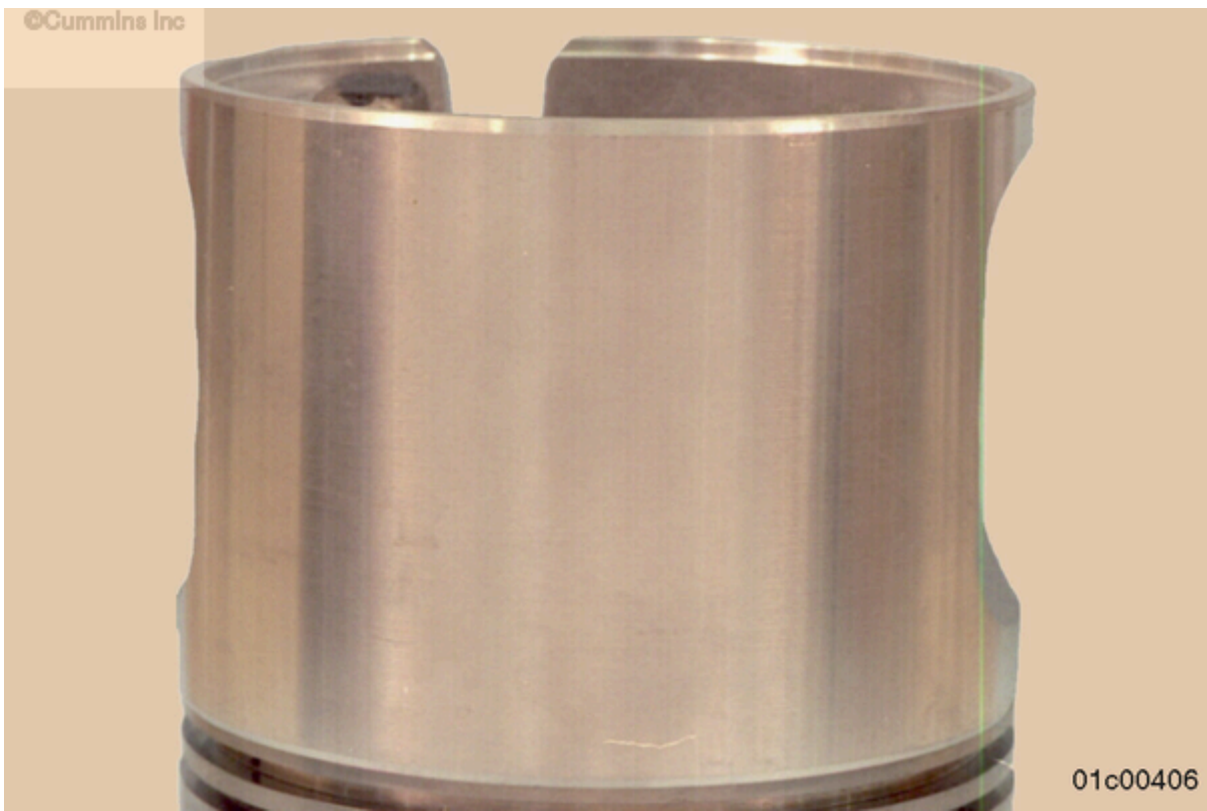


01c00406

©Cummins Inc



01c00407

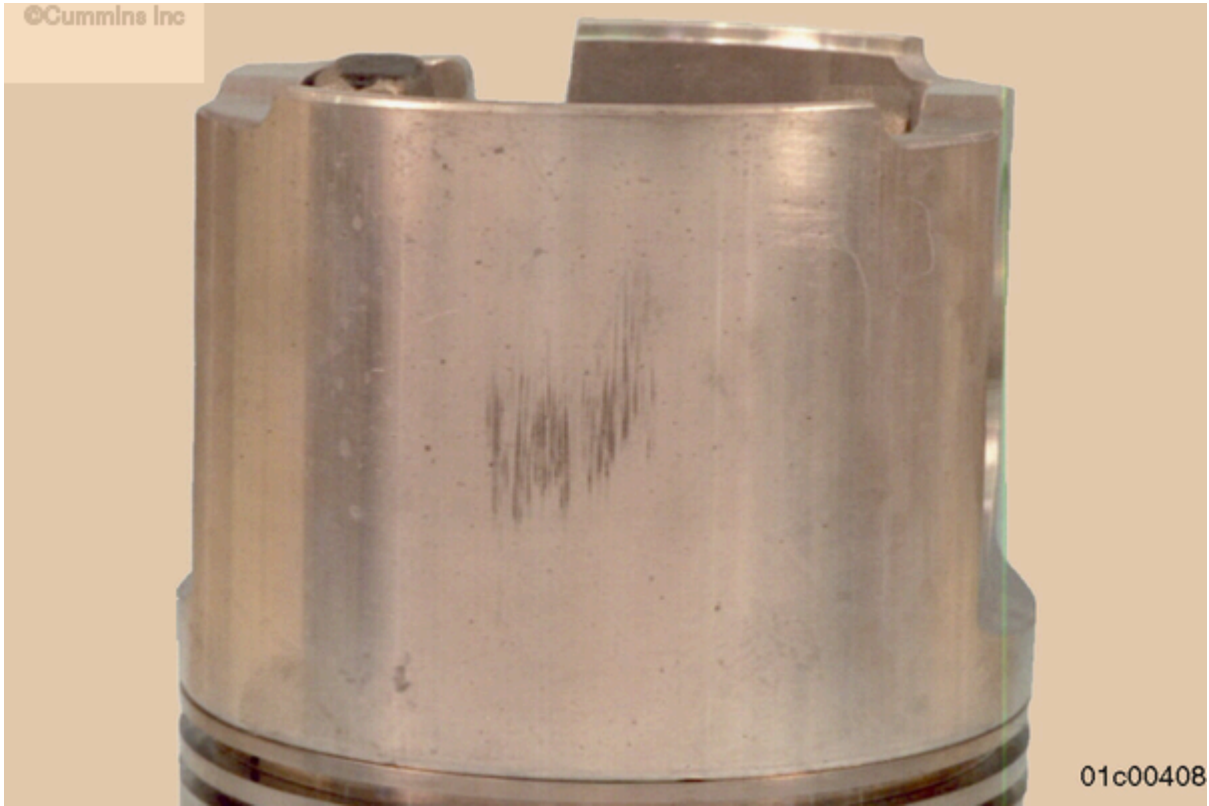

01c00408


The six digital photographs below depict piston skirts that are **not** acceptable for reuse. The scratches are deep enough to be felt with a fingernail.

©Cummins Inc



01c00409

©Cummins Inc

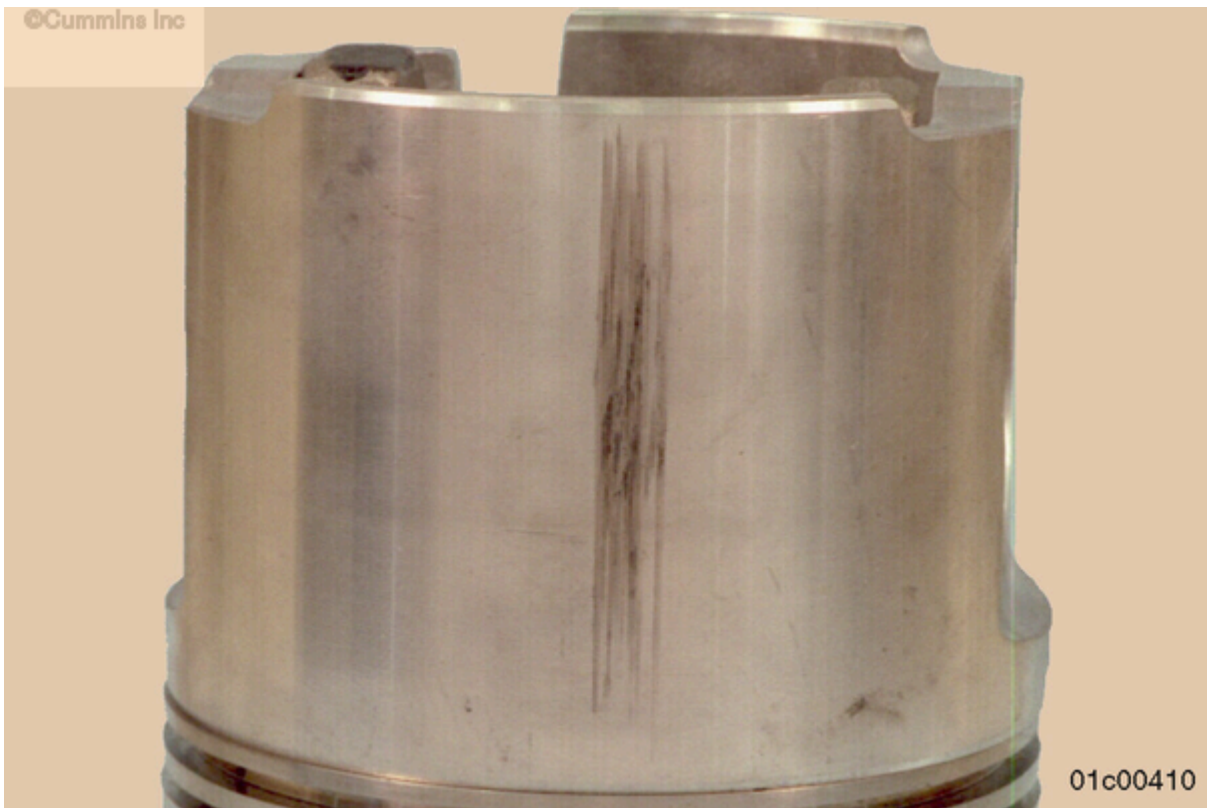


01c00410

©Cummins Inc




01c00411

©Cummins Inc

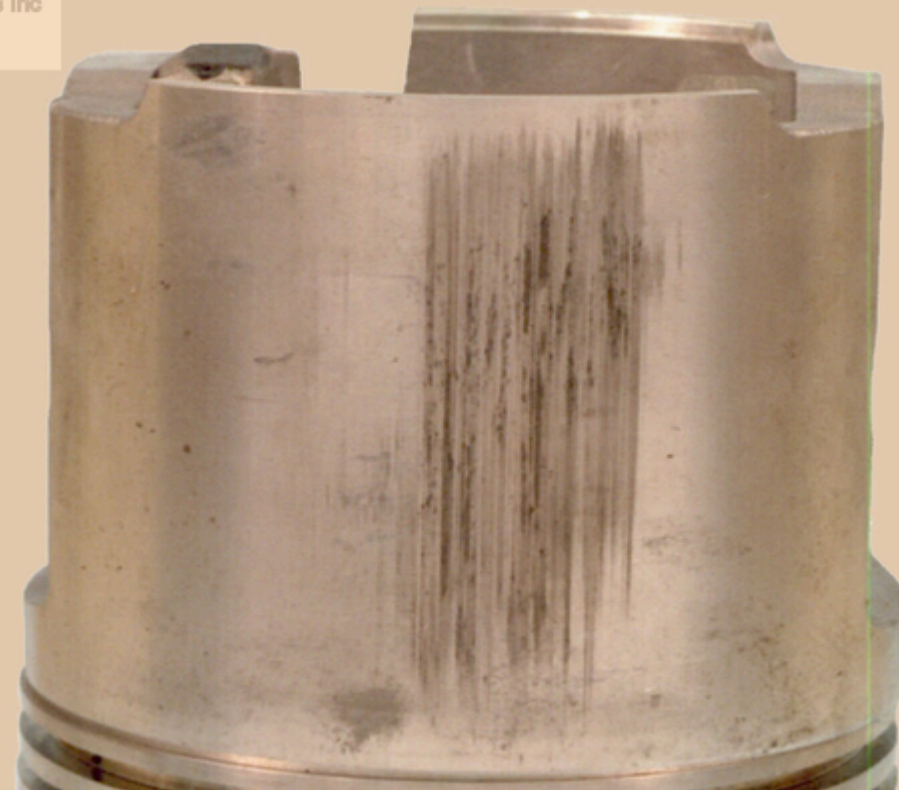

01c00412

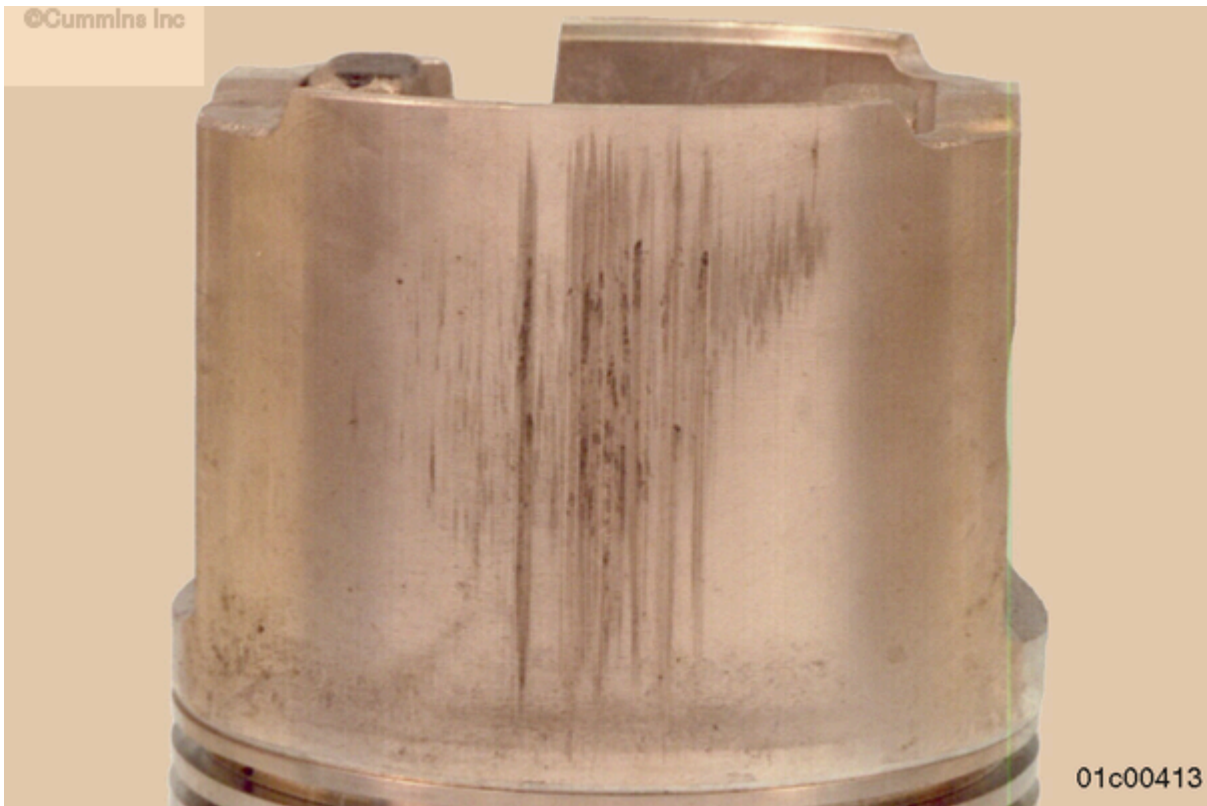

Document History

Date	Details
14-03-2017	Module Converted
2017-4-4	Update to Format

