


# Fault Code: 148

## Frequency Accelerator Circuit

 Printable Version

### Overview

| Codes                                                                                                | Reason                                                                                                                             | Effect                                               |
|------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------|
| <p>Fault Code: 148</p> <p>PID(P): P91</p> <p>SPN: 091</p> <p>FMI: 8</p> <p>Lamp: Red</p> <p>SRT:</p> | <p>A frequency of more than 1500 Hz has been detected at the frequency accelerator signal pin 17 of the OEM interface harness.</p> | <p>Calibration-dependent power and speed derate.</p> |

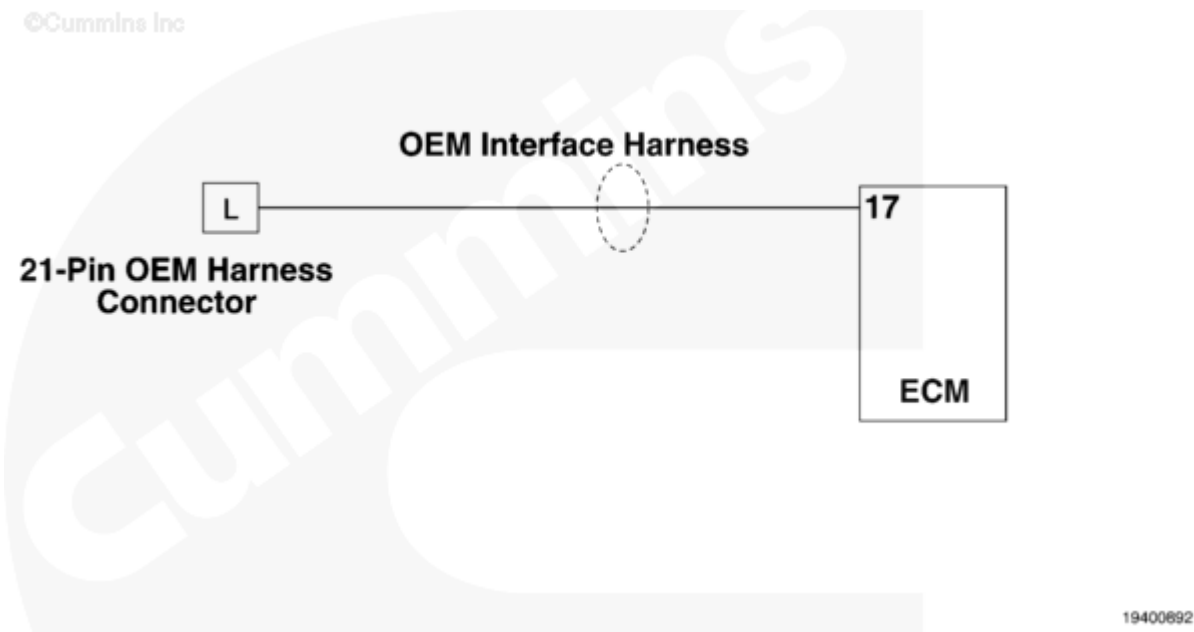

Frequency Accelerator Circuit

### Circuit Description

The frequency accelerator provides the driver's accelerator command to the ECM through the OEM harness and the OEM interface harness. The ECM uses this signal to determine the fueling command.

### Component Location

Accelerator location varies with each OEM. Refer to the OEM manual.

## Shoptalk

The frequency accelerator can be used either in conjunction with a voltage accelerator or by itself.

Refer to Troubleshooting Fault Code t05-148 (</qs3/pubsys2/xml/en/procedures/19/19-t05-148.html>)

---

**Last Modified: 01-Mar-2011**

---