

Fault Code: 343


Electronic Control Module (ECM) Internal Communication Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 343 PID(P): S254 SPN: 629 FMI: 12 Lamp: Yellow SRT: 00-341	Microprocessor communication error internal to the ECM.	Variable; performance will or will not be affected.

©Cummins Inc

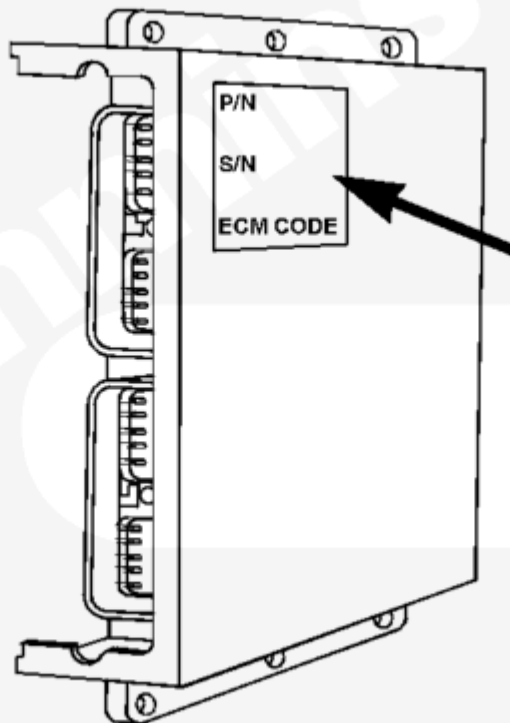

19400316

Electronic Control Module

Circuit Description

The ECM is a computer that is responsible for engine control, diagnostics, and user features.

Component Location

The ECM is bolted to the control valve body on the left side of the engine.

Shoptalk

- This is a fault with the internal circuitry of the ECM. There are no repairs possible for the module in the field.

Refer to Troubleshooting Fault Code t05-343 (</qs3/pubsys2/xml/en/procedures/19/19-t05-343.html>)

Last Modified: 01-Mar-2011
