


Fault Code: 668

Exhaust Gas Temperature Deviation High for Cylinder 15 - Data Valid But Above Normal Operating Range - Moderately Severe Level

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 668 PID(P): SPN: 1337 FMI: 0/16 Lamp: Amber SRT: CE-668	Exhaust Gas Temperature Deviation High for Cylinder 15 - Data Valid But Above Normal Operating Range - Moderately Severe Level. Cylinder 15 exhaust temperature is above the normal operating range.	No action taken.

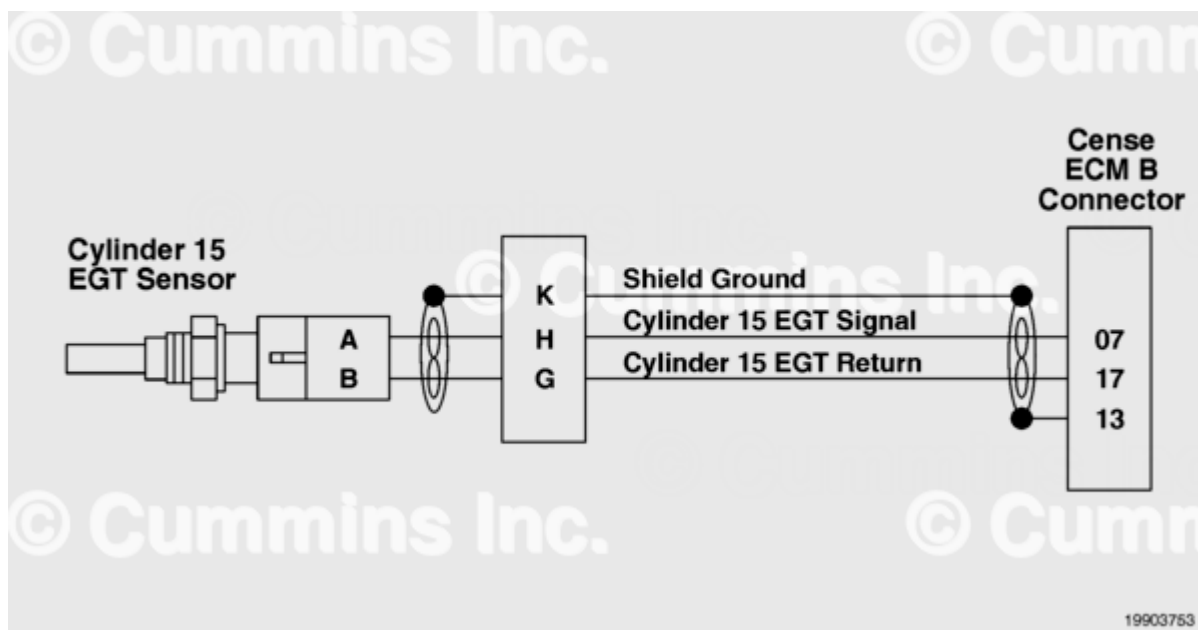

Exhaust Gas Temperature Sensor Circuit Cylinder 15

Circuit Description

The exhaust gas temperature sensor circuit monitors exhaust gas temperature for cylinder 15 and passes the information to the CENSE™ engine control module (ECM) through the engine harness. The ECM monitors the temperature and compares it to the exhaust gas temperatures of

other cylinders.

Component Location

The exhaust gas temperature sensor for cylinder 15 is located at the cylinder head-to-exhaust manifold interface.

Shoptalk

There are multiple CENSE™ ECMs for the engine models included in this manual. The ECM model displays when INSITE™ electronic service tool is connected. When troubleshooting a fault code, use the ECM model displayed in INSITE™ electronic service tool to determine which cylinder is affected. For engines with the present CM2330 ECM, the cylinder numbering sequence is described in the General Engine procedure of Section V in the QSK45 and QSK60 Service Manual, Bulletin 4021530. Refer to Procedure 018-015 in Section V.
(</qs3/pubsys2/xml/en/procedures/56/56-018-015-tr.html>)

Refer to Troubleshooting Fault Code t05-668 (</qs3/pubsys2/xml/en/procedures/81/81-t05-668.html>)