



Technical Service Bulletin

Technical Service Bulletin: tsb101652

Released Date: 13-May-2005

Capscrew Torque Revision to Cylinder Head Procedure

Capscrew Torque Revision to Cylinder Head Procedure

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Service/Parts Topic introduces a new long cylinder hex head flange capscrew, Part Number 4923187, that supersedes Part Number 3045850. This change has been implemented as a product improvement to address capscrew corrosion failures. The Engine Serial Number first is 35124397.

Note : This is a product improvement and not subject to campaign.


This topic includes the following:

- New and old part numbers (table)
- Change in torque procedure in the Install step.

Table - New and Old Part Numbers


Part Description	New Part Number	Old Part Number
Hex Flange Capscrew	4923187	3045850

The new capscrews can be mixed with the old capscrews.

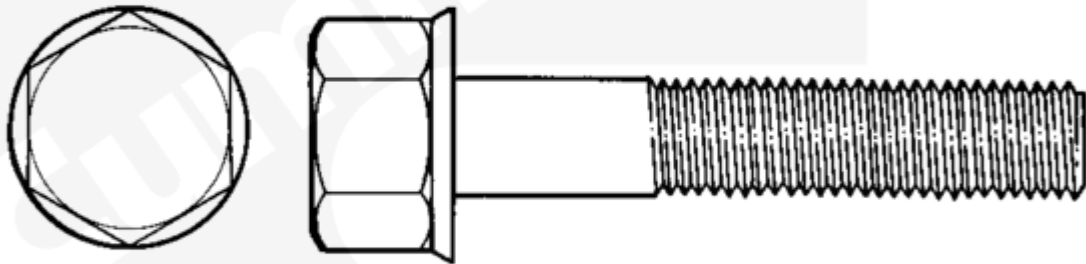

02200069

New capscrew 4923187

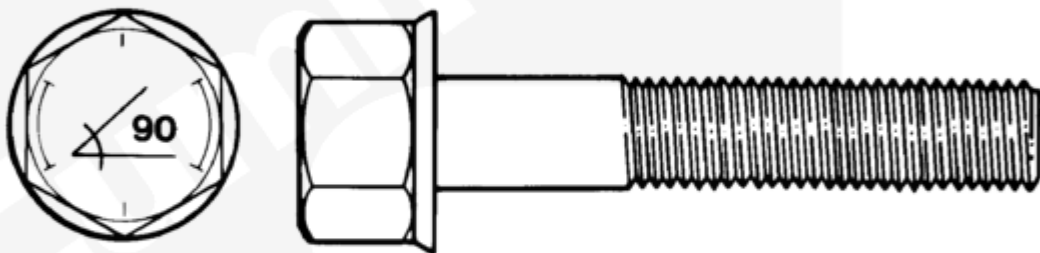

kn8csgb

Old capscrew 3045850

The new capscrews have a grey coating on them and do **not** have the 90 degree marking on the head of the capscrew.

Related Procedures

35-002-004 (/qs3/pubsys2/xml/en/procedures/35/35-002-004.html)	Cylinder Head (/qs3/pubsys2/xml/en/procedures/35/35-002-004.html)
---	--

Last Modified: 13-May-2005