



Technical Service Bulletin

Technical Service Bulletin: TSB110079

Released Date: 25-Mar-2011

New ISX and QSX15 Cylinder Liner

New ISX and QSX15 Cylinder Liner

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.


Contents

This document introduces a new ISX and QSX15 cylinder liner. This new liner has the thickness of the top press fit ledge reduced. This reduced press fit ledge allows for better cooling of the top ring reversal area, which improves the liner's resistance to wear in this area.

©Cummins Inc

Old Liner (Part # 4101507)

New Liner (Part # 2882764)

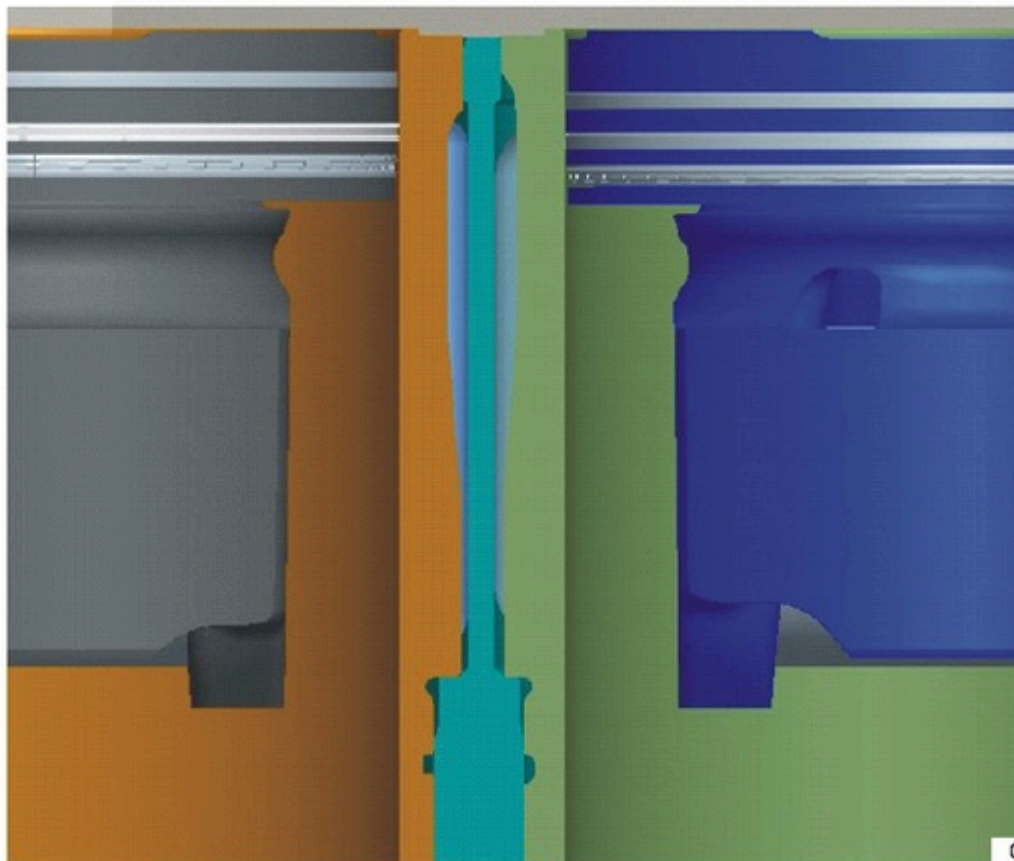

Old Cylinder Liner, Part Number 4101507 and New Cylinder Liner, Part Number 2882764

The new liner is completely backwards compatible and can be mixed and matched in an engine.

Note : This change does not affect the groove top cylinder liner, Part Numbers 3682025 and 4025192. Groove top liners will still be available for service repair.

Table 1, Cylinder Liner Supersession Information

Engine Family	New Cylinder Liner Part Number	Old Cylinder Liner Part Number	Engine Serial Number (ESN) First	Start Date
ISX and QSX15	2882764	4101507	N/A - Service Part Only	29-Dec-2010

Document History

Date	Details
2011-3-18	Module Created

Last Modified: 25-Mar-2011
