



Technical Service Bulletin

Technical Service Bulletin: TSB240195

Released Date: 30-Sep-2024

ReCon® Engines without Electronic Control Modules (ECM)

ReCon® Engines without Electronic Control Modules (ECM)

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISM CM570
- ISM CM570/870
- ISM CM876
- QSM11 CM570

Description of Change

From 29 July 2024 onwards, ReCon® engine part numbers as listed in Table 1, will be shipped without an engine control module (ECM).

Reason for Change

Supply chain constraints have caused some engines to be shipped without ECMs.

Customer Communication

Reference Table 1 for engine part numbers affected by this change.

Table 1, Affected Engine Part Numbers

Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISM 11 98 B 330@1800 CEL	DR158800RX	No	Yes	DR861200RX
ENG ISM 11 98 B 400@2100 CEL	DR171400RX	No	Yes	DR861300RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISM 11 98 B 400@2100 CEL	DR171500RX	No	Yes	DR861400RX
ENG ISM 11 98 B 330@1800 CEL	DR171700RX	No	Yes	DR861500RX
ENG QSM 11 T2 C 330@2100 CEL	DR607500RX	No	Yes	DR861600RX
ENG ISM 11 98 B 370@1800 CEL	DR614700RX	No	Yes	DR861700RX
ENG QSM 11 T2 C 330@2100 CEL	DR615300RX	No	Yes	DR861800RX
ENG ISM 11 04 B 370@2100 CEL	DR618700RX	No	Yes	DR861900RX
ENG QSM 11 T2 G 470@1800 CEL	DR619700RX	No	Yes	DR862000RX
ENG ISM 11 98 B 280@2100 CEL	DR626600RX	No	Yes	DR862100RX
ENG QSM 11 T2 C 290@2100 CEL	DR629300RX	No	Yes	DR862200RX
ENG QSM 11 T3 C 290@2100 CEL	DR629600RX	No	Yes	DR862300RX
ENG ISM 11 02 B 280@2100 CEL	DR639800RX	No	Yes	DR862400RX
ENG ISM 11 98 B 370@2100 CEL	DR640000RX	No	Yes	DR862500RX
ENG QSM 11 T2 C 400@2100 CEL	DR640300RX	No	Yes	DR862600RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISM 11 98 B 280@2100 CEL	DR640500RX	No	Yes	DR862700RX
ENG ISM 11 07 B 280@2100 CEL	DR644300RX	No	Yes	DR862800RX
ENG ISM 11 07 B 410@2100 CEL	DR644600RX	No	Yes	DR862900RX
ENG ISM 11 02 B 350@1800 CEL	DR646800RX	No	Yes	DR863000RX
ENG QSM 11 T2 M 670@2300 CEL	DR649800RX	No	Yes	DR863100RX
ENG QSM 11 T3 C 375@2100 CEL	DR651100RX	No	Yes	DR863200RX
ENG ISM 11 04 B 500@2000 CEL	DR660000RX	No	Yes	DR863300RX
ENG QSM 11 T3 C 400@2100 CEL	DR686200RX	No	Yes	DR863400RX
ENG QSM 11 T3 C 375@2100 CEL	DR687200RX	No	Yes	DR863500RX
ENG ISM 11 07 U 280@2100 CEL	DR689500RX	No	Yes	DR863600RX
ENG ISM 11 04 B 335@2100 CEL	DR690000RX	No	Yes	DR863700RX
ENG QSM 11 T3 C 335@2100 CEL	DR690100RX	No	Yes	DR863800RX
ENG ISM 11 07 B 410@2100 CEL	DR692400RX	No	Yes	DR863900RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISM 11 04 B 430@1900 CEL	DR698300RX	No	Yes	DR864000RX
ENG ISM 11 98 B 350@2100 CEL	DR701400RX	No	Yes	DR864100RX
ENG ISM 11 04 B 350@1600 CEL	DR701900RX	No	Yes	DR864200RX
ENG QSM 11 T3 G 470@1800 CEL	DR702000RX	No	Yes	DR864300RX
ENG ISM 11 98 B 370@1800 CEL	DR702400RX	No	Yes	DR864400RX
ENG ISM 11 04 B 350@1600 CEL	DR709900RX	No	Yes	DR864500RX
ENG ISM 11 07 B 350@2100 CEL	DR766400RX	No	Yes	DR864600RX
ENG ISM 11 07 B 335@2100 CEL	DR766600RX	No	Yes	DR864700RX
ENG ISM 11 98 B 425@ 2100 CEL	DR768300RX	No	Yes	DR864800RX
ENG ISM 11 98 B 370@1800 CEL	DR779600RX	No	Yes	DR864900RX

Service Instructions

When performing an engine exchange, the ECM from the existing engine **must** be retained to use on the new ReCon® engine.

Procedure:

1. Remove ECM from the core/existing engine. See corresponding Service Manual. Reference Procedure 019-031 in Section 19.

- 2. Install ECM on to the new ReCon® engine. See corresponding Service Manual. Reference Procedure 019-031 in Section 19.
- 3. Update the Engine serial number in ECM with ReCon® engine serial number.
- 4. All affected ReCon® engines will arrive with a hang tag (see Figure 1) in place of the ECM. This hang tag **must** be attached to the core engine prior to being returned.

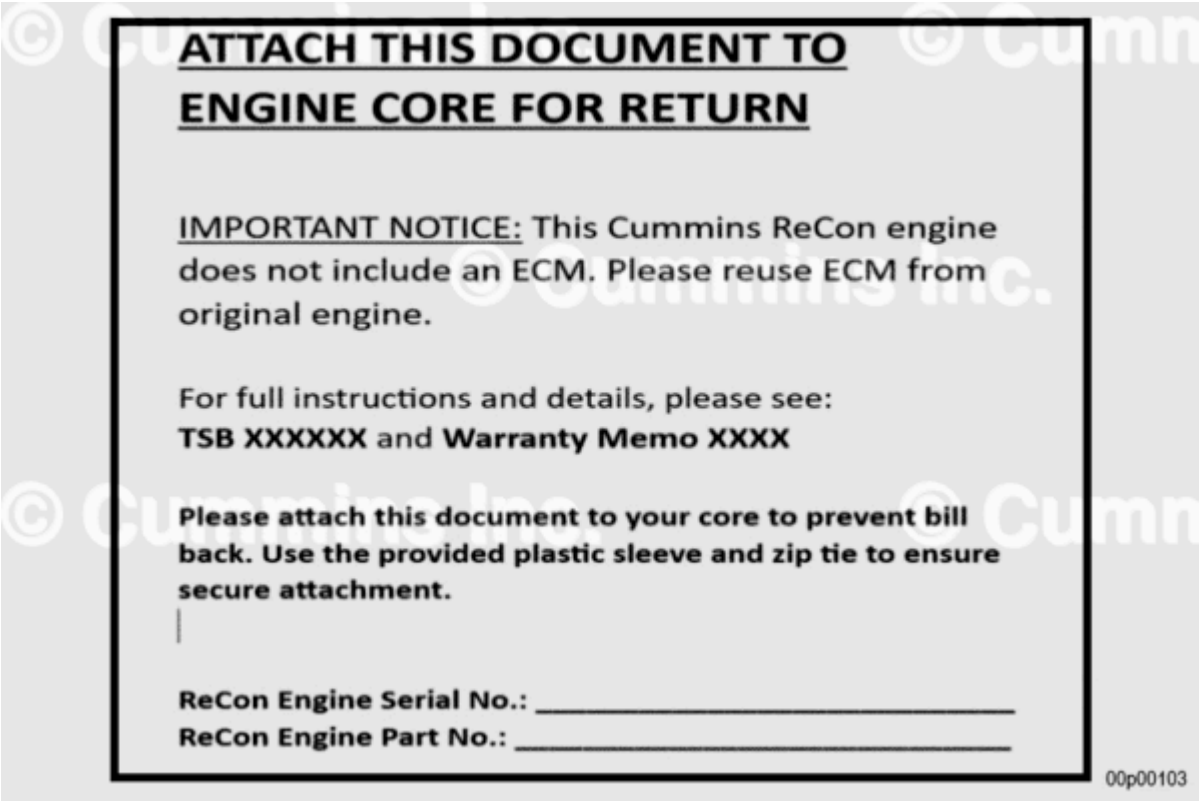


Figure 1, Hang Tag Put in Place of the ECM

Document History

Date	Details
2024-9-30	Module Created