



Technical Service Bulletin: tsb100296

Released Date: 25-Aug-2004

New Oil Pan Adapter Seal

New Oil Pan Adapter Seal

Warranty Statement


The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a material change for the rectangular strip seal on the rear of the oil pan adapter. The seal will change from Nitrile to Viton to prevent hardening of the seal due to high temperatures. Nitrile seals will work for most applications.

The existing seal has a diagonal line across both ends (Figure 1). The new seal has no mark (Figure 2).

©Cummins Inc

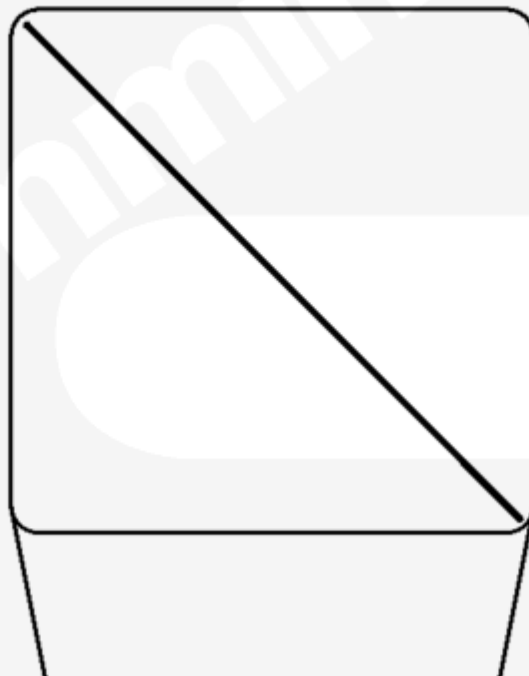

01400629

Figure 1, Current Seal with Diagonal Mark



01400630

Figure 2, New Seal Without Diagonal Mark

Repair procedures will remain the same.

The current seal will **not** be removed from kits that are in stock. Order the new seal separately until they are included in affected kits.

Table 1, New Oil Pan Adapter Seal

Table 1, New Oil Pan Adapter Seal				
Current Part Number	New Part Number	Description	Quantity	Affected Kits
3069844	4910518	Seal, Rectangular Strip	2	4089390, 4089391, 4089717

Note : This is a product improvement and is **not** subject to campaign.