



Technical Service Bulletin

Technical Service Bulletin: TSB180024

Released Date: 28-Feb-2018

New Engine Piston Kits with Diamond Like Coated Piston Pins

New Engine Piston Kits with Diamond Like Coated Piston Pins

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

Engines:

- QSX15 CM2350 X106
- QSX15 CM570
- QSX15 CM2250

Controlled Product Lists:

- 3961
- 8587
- 8588

Description of Change

- A new diamond like coated piston pin and service kits are available.
- New diamond like coated piston pin is darker in color. See Figures 1 and 2 below.

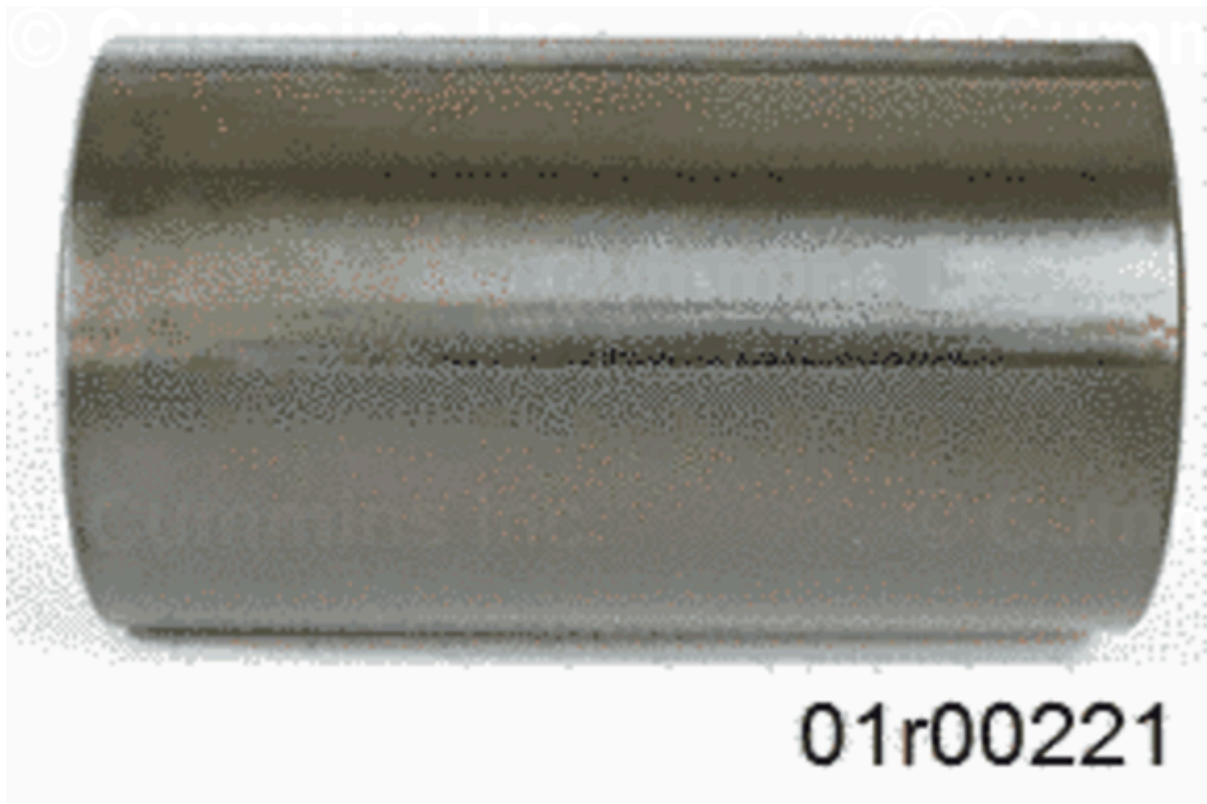


Figure 1, Existing Piston Pin.

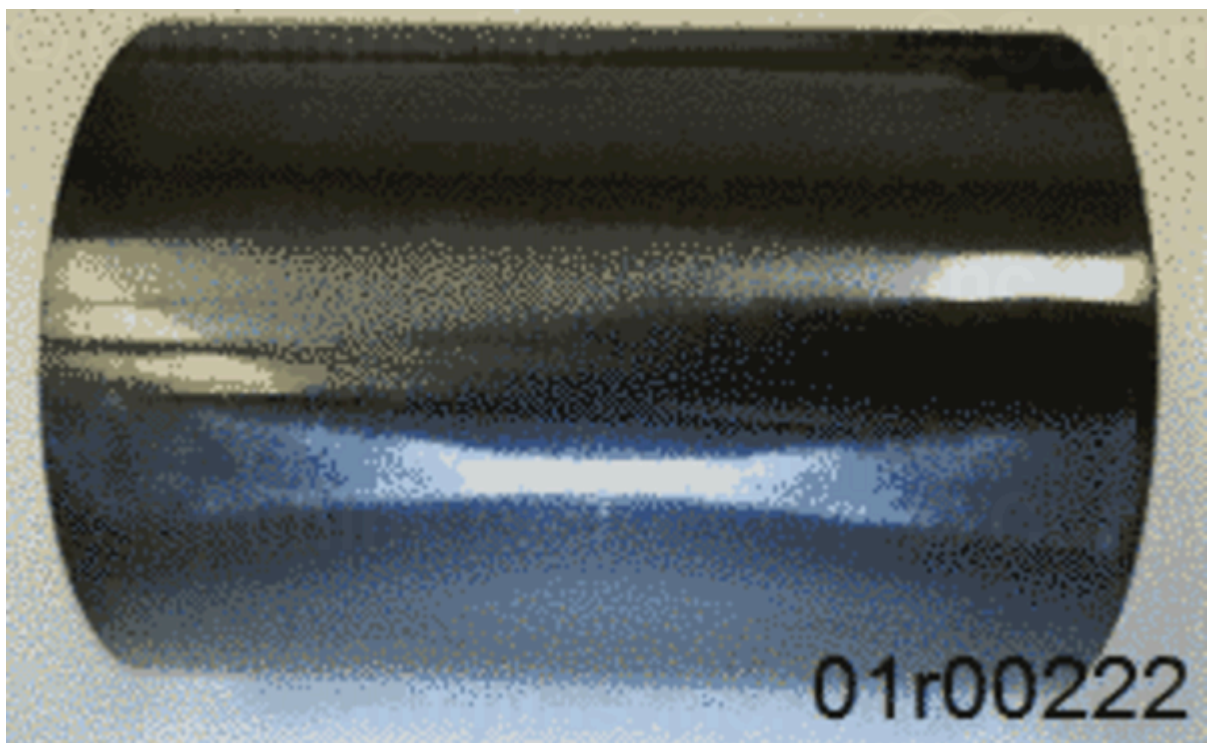


Figure 2, Diamond Like Coated Piston Pin.

Reason for Change

New diamond like coated piston pin increases piston pin joint service life.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
kit, engine piston	4376246	No	No	5473086
kit, engine piston	4376567	No	No	5473087

Production Status

Implemented for production. See Table 2

Table 2, Production Information		
ESN First	Build Date ¹	Plant
80031461	21 December 2017	Jamestown Engine Plant
¹ Engine build date can be found on the engine dataplate.		

Document History

Date	Details
2018-2-27	Module Created