



Technical Service Bulletin

Technical Service Bulletin: TSB230228

Released Date: 07-Mar-2024

ReCon® Engines Without Electronic Control Modules (ECM)

ReCon® Engines Without Electronic Control Modules (ECM)

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- ISX CM570
- ISX CM870
- ISX CM871
- ISX12 CM2250
- ISX12 CM2350 X102
- ISX12 G CM2180 EJ
- ISX12N CM2380 X120B
- ISX15 CM2250
- ISX15 CM2250 SN
- ISX15 CM2350 X101
- ISX15 CM2350 X105
- ISX15 CM2350 X116B
- QSX15 CM2250 ECF
- QSX15 CM570
- QSX15 CM2350 X106
- QSX15 CM2250 X115
- QSX15 CM2350 X118
- QSX15 CM570 X147G

Description of Change

From 01 January 2024 onwards, ReCon® engine part numbers as listed in Table 1 below, will be shipped without an ECM (engine control module).

Reason for Change

Supply chain constraints have caused some engines to be shipped without ECMs.

Customer Communication

Reference Table 1 for engine part numbers affected by this change.

When doing an engine exchange, the ECM from the existing engine **must** be retained to use on the new ReCon® engine.

Table 1, Affected Engine Part Numbers

Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISX 11.9 13 B 425 at 1800 XPI_CM2350	DR0708300RX	No	No	DR0708300RX
ENG ISX 15 13 B 450 at 1650 XPI_CM2350	DR0704600RX	No	No	DR0704600RX
ENG ISX 15 13 B 500 at 1800 XPI_CM2350	DR0707900RX	No	No	DR0707900RX
ENG ISX 15 13 B 600 at 1900 XPI_CM2350	DR0708000RX	No	No	DR0708000RX
ENG ISX 15 13 B 450 at 1800 XPI_CM2350	DR0773900RX	No	No	DR0773900RX
ENG ISX 11.9 425 at 1800 AUTOMOTIVE_C M2250	DR0659900RX	No	Yes	DR0799200RX
ENG ISX 11.9 13 B 400 at 1800 CNG_CM2380A	DR0704500RX	No	Yes	DR0799300RX
ENG ISX 11.9 13 B 425 at 1800 XPI_CM2350	DR0708500RX	No	Yes	DR0799400RX
ENG ISX 11.9 13 B 400 at 1800 CNG_CM2380A	DR0768700RX	No	Yes	DR0799500RX
ENG ISX 15 02 B 400 at 1800 APX_CM570	DR0147000RX	No	Yes	DR0793800RX
ENG ISX 15 02 B 500 at 2000 APX_CM570	DR0150100RX	No	Yes	DR0793900RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISX 15 02 B 600 at 2000 APX_CM570	DR0047200RX	No	Yes	DR0794200RX
ENG ISX 15 02 B 500 at 2000 APX_CM570	DR0624900RX	No	Yes	DR0794800RX
ENG ISX 15 02 B 565 at 2000 APX_CM570	DR0625000RX	No	Yes	DR0794900RX
ENG ISX 15 02 B 475 at 2000 APX_CM570	DR0625100RX	No	Yes	DR0795000RX
ENG ISX 15 02 B 450 at 1800 APX_CM570	DR0625500RX	No	Yes	DR0795200RX
ENG ISX 15 04 B 500 at 2000 HPI_CM870	DR0166300RX	No	Yes	DR0794000RX
ENG ISX 15 04 B 450 at 1800 HPI_CM870	DR0168000RX	No	Yes	DR0794100RX
ENG ISX 15 04 B 565 at 2000 HPI_CM870	DR0615200RX	No	Yes	DR0794600RX
ENG ISX 15 04 B 450 at 1800 HPI_CM871	DR0693200RX	No	Yes	DR0796300RX
ENG ISX 15 07 B 450 at 1800 HPI_CM871	DR0643600RX	No	Yes	DR0795500RX
ENG ISX 15 07 B 550 at 2000 HPI_CM871	DR0643700RX	No	Yes	DR0795600RX
ENG ISX 15 07 B 500 at 1800 HPI_CM871	DR0643900RX	No	Yes	DR0795700RX
ENG ISX 15 07 B 500 at 2000 HPI_CM871	DR0698000RX	No	Yes	DR0796500RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISX 15 07 B 500 at 2000 HPI_CM871	DR0698500RX	No	Yes	DR0796600RX
ENG ISX 15 07 B 500 at 2000 HPI_CM871	DR0698600RX	No	Yes	DR0796700RX
ENG ISX 15 07 B 500 at 2000 HPI_CM871	DR0698700RX	No	Yes	DR0796800RX
ENG ISX 15 07 B 500 at 2000 HPI_CM871	DR0767300RX	No	Yes	DR0797800RX
ENG ISX 15 10 B 525 at 1800 XPI_CM2250	DR0658800RX	No	Yes	DR0795900RX
ENG ISX 15 10 B 400 at 1800 XPI_CM2250	DR0659000RX	No	Yes	DR0796000RX
ENG ISX 15 10 B 485 at 1800 XPI_CM2250	DR0659200RX	No	Yes	DR0796100RX
ENG ISX 15 10 B 450 at 1800 XPI_CM2250	DR0696900RX	No	Yes	DR0796400RX
ENG ISX 15 10 B 600 at 1800 XPI_CM2250	DR0700400RX	No	Yes	DR0797100RX
ENG ISX 15 13 B 500 at 1800 XPI_CM2350	DR0774000RX	No	Yes	DR0798300RX
ENG ISX 15 16 B 450 at 1800XPI_CM235 0A	DR0770800RX	No	Yes	DR0798000RX
ENG ISX 15 16 B 450 at 1800 XPI_CM2350A	DR0779200RX	No	Yes	DR0798600RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG ISX 15 98 B 520 at 1900 APX_CM570	DR0698800RX	No	Yes	DR0796900RX
ENG ISX 15 98 B 475 at 2000 APX_CM570	DR0699200RX	No	Yes	DR0797000RX
ENG ISX 15 98 B 500 at 2000 APX_CM570	DR0702200RX	No	Yes	DR0797200RX
ENG ISX 15 98 B 600 at 2000 APX_CM570	DR0702300RX	No	Yes	DR0797300RX
ENG ISX 15 E5 B 500 at 2000 XPI_CM2250	DR0766900RX	No	Yes	DR0797600RX
ENG QSX 15 T1 C 440 at 2000 HPI_CM570	DR0644100RX	No	Yes	DR0795800RX
ENG QSX 15 T2 C 500 at 2100 HPI_CM570	DR0602700RX	No	Yes	DR0794300RX
ENG QSX 15 T2 C 425 at 2000 HPI_CM570	DR0602800RX	No	Yes	DR0794400RX
ENG QSX 15 T2 G 670 at 1500 HPI	DR0655300RX	No	No	DR0655300RX
ENG QSX 15 T2 G 755 at 1800 HPI	DR0655400RX	No	No	DR0655400RX
ENG QSX 15 T2 C 600 at 2100 HPCR_CM570	DR0687300RX	No	Yes	DR0796200RX
ENG QSX 15 T3 C 500 at 2100 HPI_CM570	DR0728500RX	No	Yes	DR0860800RX
ENG QSX 15 T3 C 380 at 2100 HPI_CM570	DR0615100RX	No	Yes	DR0794500RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG QSX15 T3 C 530 at 1800 HPI_CM570	DR0623400RX	No	Yes	DR0794700RX
ENG QSX 15 T3 C 600 at 1800 HPI_CM570	DR0625300RX	No	Yes	DR0795100RX
ENG QSX 15 T3 C 520 at 2100 HPI_CM570	DR0633800RX	No	Yes	DR0795300RX
ENG QSX 15 T3 C 485 at 2000 HPI_CM570	DR0641600RX	No	Yes	DR0795400RX
ENG QSX 15 T3 C 665 at 2100 HPI_CM570	DR0766100RX	No	Yes	DR0797500RX
ENG QSX 15 T3 C 600 at 1800 HPI_CM570	DR0767000RX	No	Yes	DR0797700RX
ENG QSX15 T3 C 665 at 2100 HPI_CM570	DR0772600RX	No	Yes	DR0798200RX
ENG QSX 15 T3 C 390 at 2000 HPI_CM570	DR0779000RX	No	Yes	DR0798400RX
ENG QSX 15 T3 C 520 at 2100 HPI_CM570	DR0779100RX	No	Yes	DR0798500RX
ENG QSX 15 T4F C 600 at 2100 XPI_CM2350	DR0728300RX	No	Yes	DR0860700RX
ENG QSX 15 T4i C 580 at 2100 XPI_CM2250	DR0728700RX	No	Yes	DR0860900RX
ENG QSX 15 T4F C 600 at 2100 XPI_CM2350	DR0728800RX	No	Yes	DR0861000RX
ENG QSX 15 T4I C 550 at 2100 XPI_CM2250	DR0704700RX	No	Yes	DR0797400RX

Table 1, Affected Engine Part Numbers				
Part Description	Existing Engine Part Number	Obsolete	Superseded	New Engine Part Number
ENG QSX 15 T4 C 600 at 1800 XPI_CM2250	DR0767600RX	No	Yes	DR0797900RX
ENG QSX15 T4 C 675 at 2100 XPI_CM2350	DR0772500RX	No	Yes	DR0798100RX
ENG ISX 12N 18 B 400 at 1800 CNG_CM2380A	DR0788700RX	No	Yes	DR0799600RX
ENG X15 17 B 450 at 1800 XPI (X1Non- Endurant)_CM23 50	DR0787300RX	No	Yes	DR0798700RX
ENG X15 17 B 450 at 1800 XPI (X1 - Endurant)_CM23 50	DR0787400RX	No	Yes	DR0798800RX
ENG X15 17 B 565 at 1950 XPI (X3 Non- Endurant)_CM23 50	DR0787500RX	No	Yes	DR0798900RX

When doing an engine exchange, the ECM from the existing engine **must** be retained to use on the new ReCon® engine.

Service Instructions

Procedure:

- Remove ECM from the core/existing engine. See corresponding Service Manual. Reference Procedure 019-031 in Section 19.
- Install ECM on to the new ReCon® engine. See corresponding Service Manual. Reference Procedure 019-031 in Section 19.
- Once an ECM is installed, an injector reset **must** be completed with INSITE™ electronic service tool. INSITE™ electronic service tool version 7.5.3 or newer is required to complete the injector reset.
- For injector reset instructions, see corresponding Service Manual. Reference Procedure 006-026 in Section 6 (Finishing step of Service Procedure 006-026).

- Update with latest ECM calibration available. See corresponding Service Manual. Reference Procedure 019-032 in Section 19.
- Update the Engine serial number in ECM with ReCon® engine serial number.
- All affected ReCon® engines will arrive with a hang tag (see Figure 1 below) in place of the ECM. This hang tag **must** be attached to the core engine prior to being returned.

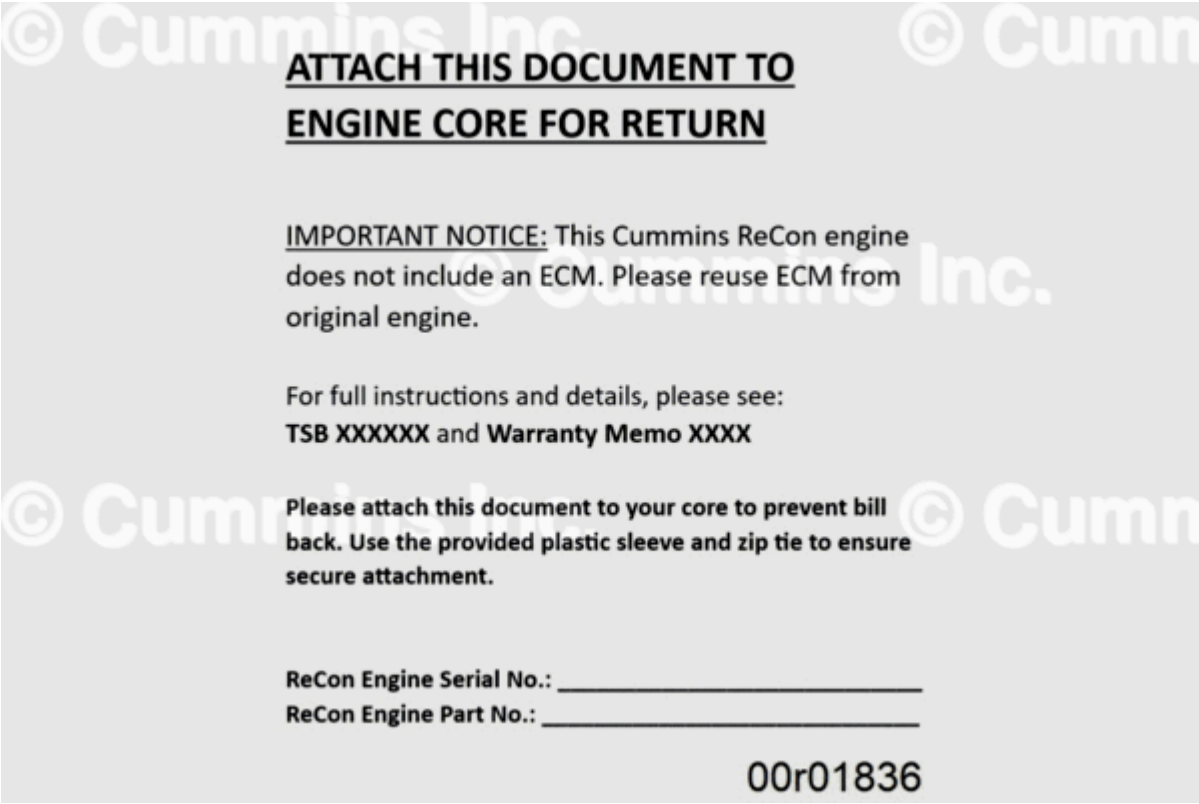


Figure 1, Hang Tag Put in Place of the ECM.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Document History

Date	Details
2023-11-16	Module Created
2024-3-7	Removed DR2711600RX.