



Technical Service Bulletin

Technical Service Bulletin: TSB240060

Released Date: 19-Mar-2024

New Rocker Lever Cover Part Number

New Rocker Lever Cover Part Number

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- 15N CM2380 104B
- 15N CM2380 105B

Description of Change

A new rocker lever cover part number has been released.

The position of the lubricating oil filler cap at the rear of the rocker lever cover is occupied by a new pressure relief valve.

Service Parts

Service parts are offered. See Table 1 for part numbers.

Table 1, Service Parts

Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Rocker Lever Cover	5668487	Yes	No	6462747
Pressure Relief Valve	6471803	-	-	-

Part Compatibility

If using a new rock lever cover, Part Number 6462747, a pressure relief valve, Part Number 6471803, should be ordered together.

Part Identification

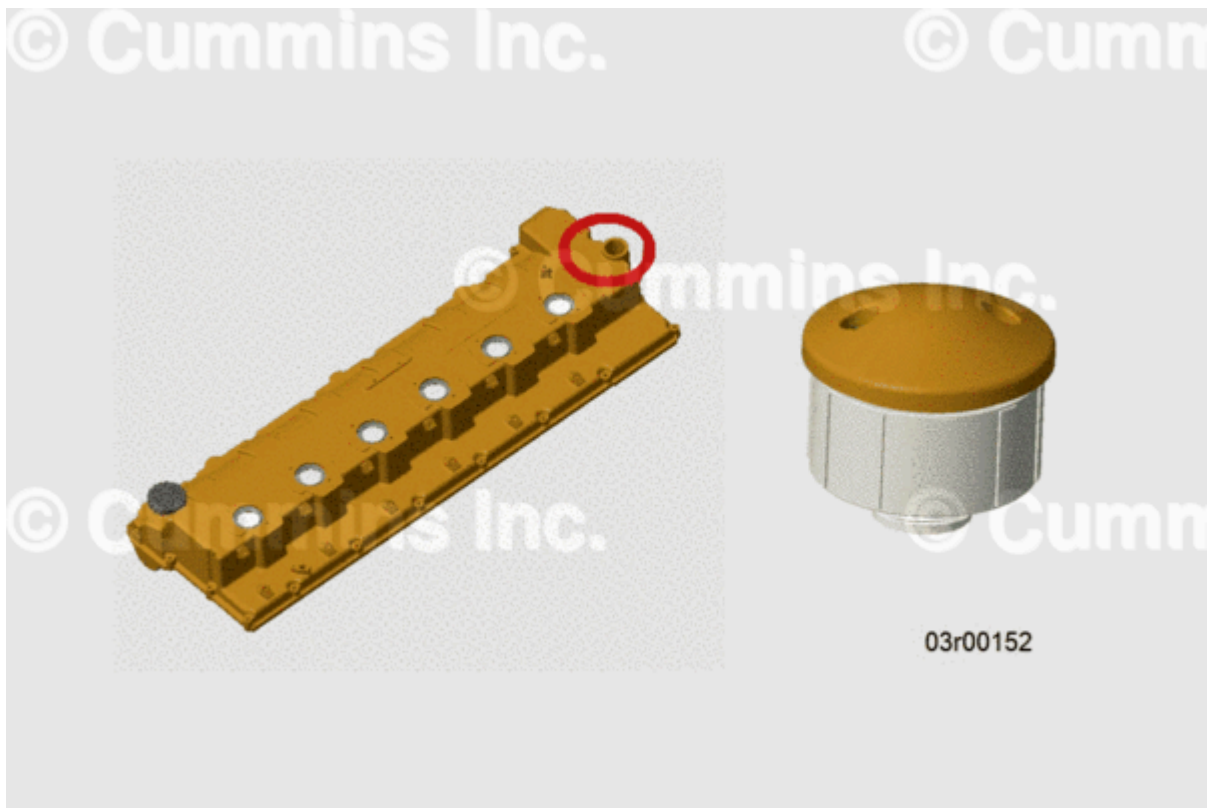


Figure 1, Rocker Lever Cover, Pressure Relief Valve, and Pressure Relief Valve Location.

Part Inventory Action

Use existing part number inventory before using the new part number.

Document History

Date	Details
2024-3-18	Module Created