


# Fault Code: 497

## MultiUnit Synchronous Switch Error

 Printable Version

### Overview

| Codes                                                                                                     | Reason                                                                                                                      | Effect                                     |
|-----------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------|--------------------------------------------|
| <p>Fault Code: 497</p> <p>PID(P): S114</p> <p>SPN: 1377</p> <p>FMI: 2</p> <p>Lamp: Yellow</p> <p>SRT:</p> | Multiunit synchronous on/off switch and multiunit synchronous complimentary on/off switch have different values at the ECM. | Multiunit synchronous feature is disabled. |

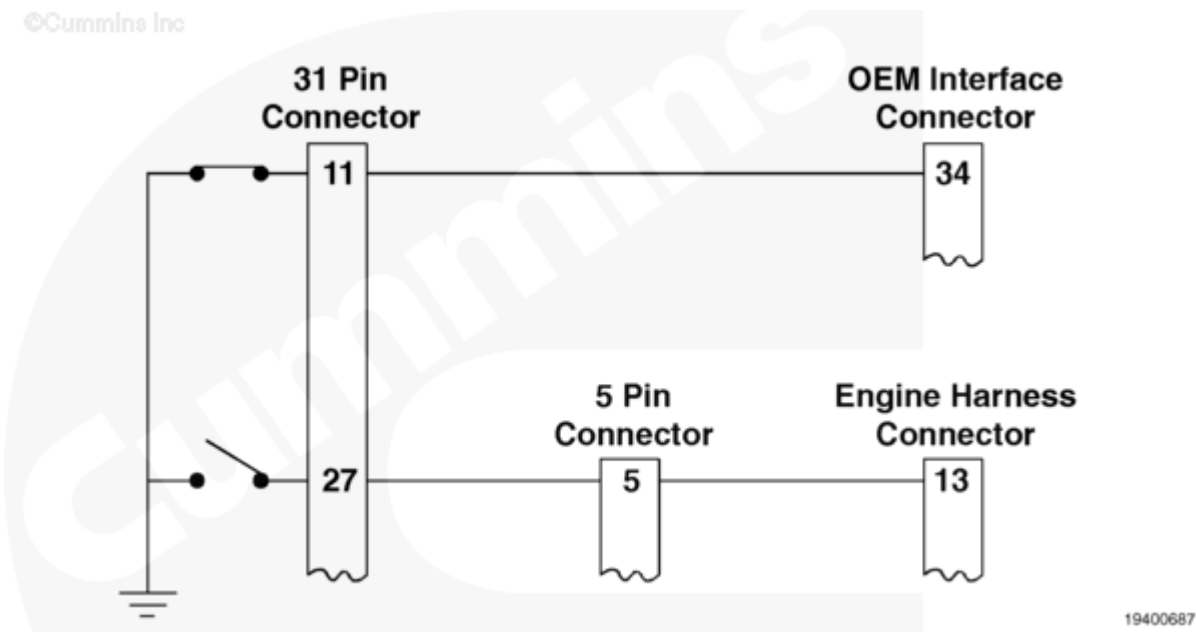

MultiUnit Synchronous Switch Circuit

### Circuit Description

The multiunit synchronous uses a complimentary switch to provide two opposite signals into the ECM.

### Component Location

The multiunit synchronous switch is cab-mounted. Refer to the OEM manual for specific location.

Refer to Troubleshooting Fault Code t05-497 (</qs3/pubsys2/xml/en/procedures/19/19-t05-497.html>)

---

**Last Modified: 01-Mar-2011**

---