

Fault Code: 1476


Engine Control Module Base Board Not Responding to LonWorks Board

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 1476 PID(P): SPN: FMI: Lamp: Warning SRT:	ECM base board is not responding to the LonWorks board.	No action is taken by the ECM.

©Cummins Inc

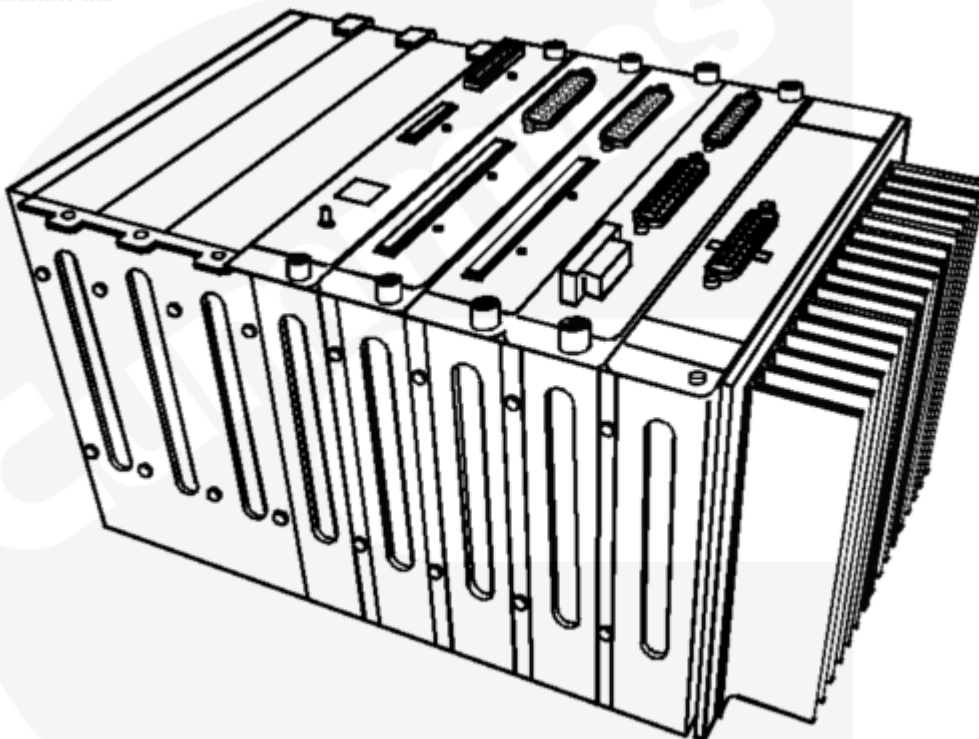

19802649

Generator Set ECM Card Cage

Circuit Description

This fault code is used by the engine control module (ECM) to tell the operator that the base board is **not** responding to commands sent via the LonWorks board.

Component Location

Reference Section E for location of the ECM card cage, the base board, and the LonWorks Network board.

Shoptalk

The possible failure modes are incorrect installation of the base board, LonWorks board, and loading an incorrect software calibration into the ECM.

Refer to Troubleshooting Fault Code t05-1476. (</qs3/pubsys2/xml/en/procedures/01/01-t05-1476.html>)

Last Modified: 08-May-2012
