


Fault Code: 155

Intake Manifold Temperature Number 1 High - Critical

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 155 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Engine intake manifold air temperature has exceeded the alarm (shutdown) threshold for high intake manifold temperature.	Engine will shut down. High engine temperature (HET) relay driver is energized

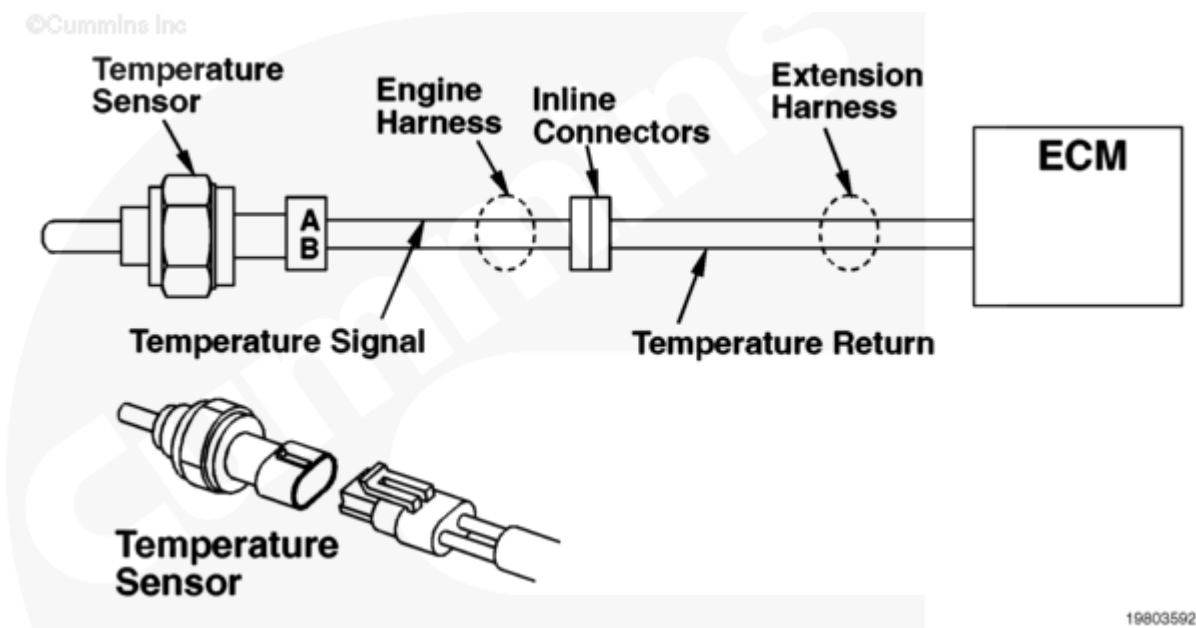

Intake Manifold Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor is used by the ECM to monitor the temperature of the air in the intake manifold after the aftercooler. The intake manifold temperature sensor is used by the ECM for the engine protection system, timing, and fueling control. If the voltage is low, the ECM will log Fault Code 155. Low voltage can be caused by a cooling system failure or an in-range sensor failure.

Component Location

Refer to the Engine Diagrams in Section E of this manual for the component location.

Shoptalk

The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-155 (</qs3/pubsys2/xml/en/procedures/01/01-t05-155.html>)

Last Modified: 29-Jul-2010
