


Fault Code: 488

Intake Manifold Temperature Number 1 High - Warning

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 488 PID(P): SPN: FMI: Lamp: Warning SRT:	Engine intake manifold air temperature has exceeded the warning threshold for high intake manifold temperature.	Calibration-dependent. No action is taken by the engine control module, or engine shutdown as temperature increases over thresholds. Pre-HET relay driver is energized.

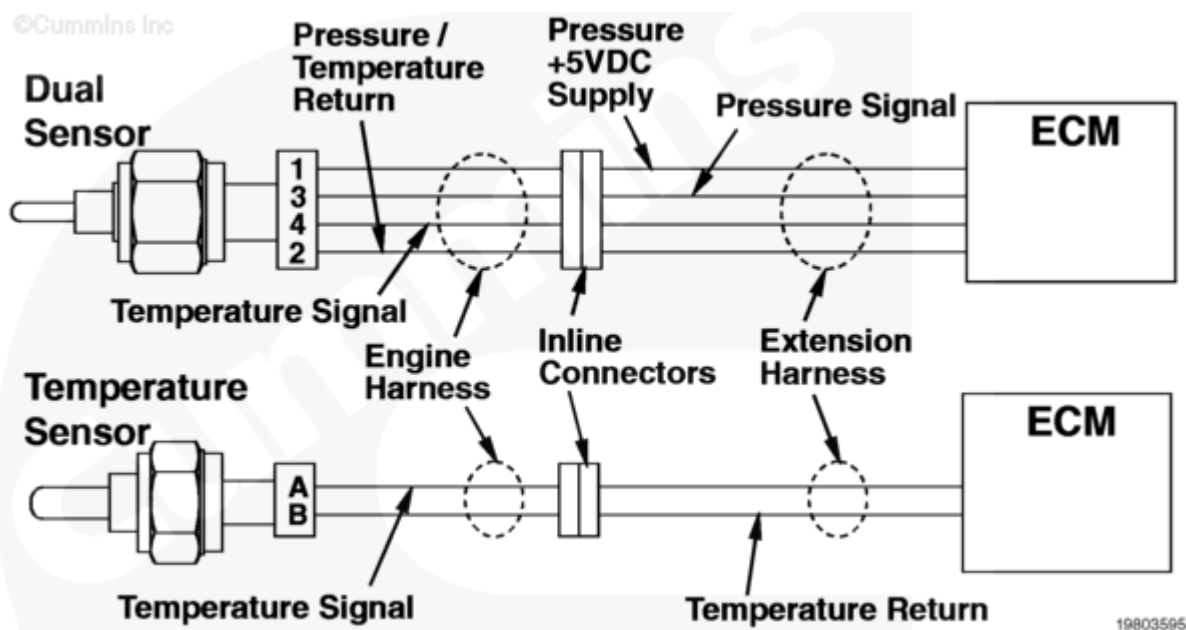

Intake Manifold Temperature Sensor Circuit

Circuit Description

The intake manifold temperature sensor is used by the electronic control module (ECM) to monitor the temperature of the air in the intake manifold after the aftercooler. The intake manifold temperature is used by the ECM for the engine protection system, timing, and fueling control.

Component Location

Refer to the Engine Diagrams. 100-002 (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

The resistance of the sensor varies with the temperature.

Refer to Troubleshooting Fault Code t05-488 (/qs3/pubsys2/xml/en/procedures/01/01-t05-488.html)

Last Modified: 29-Jul-2010
