


Fault Code: 689

Crankshaft Engine Speed Sensor Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 689 PID(P): SPN: FMI: Lamp: Shutdown SRT:	Primary engine speed sensor error. No engine speed signal detected from the crankshaft engine speed sensor.	No action taken by the ECM. Engine will continue to run on the camshaft engine position sensor. Possible loss of performance.

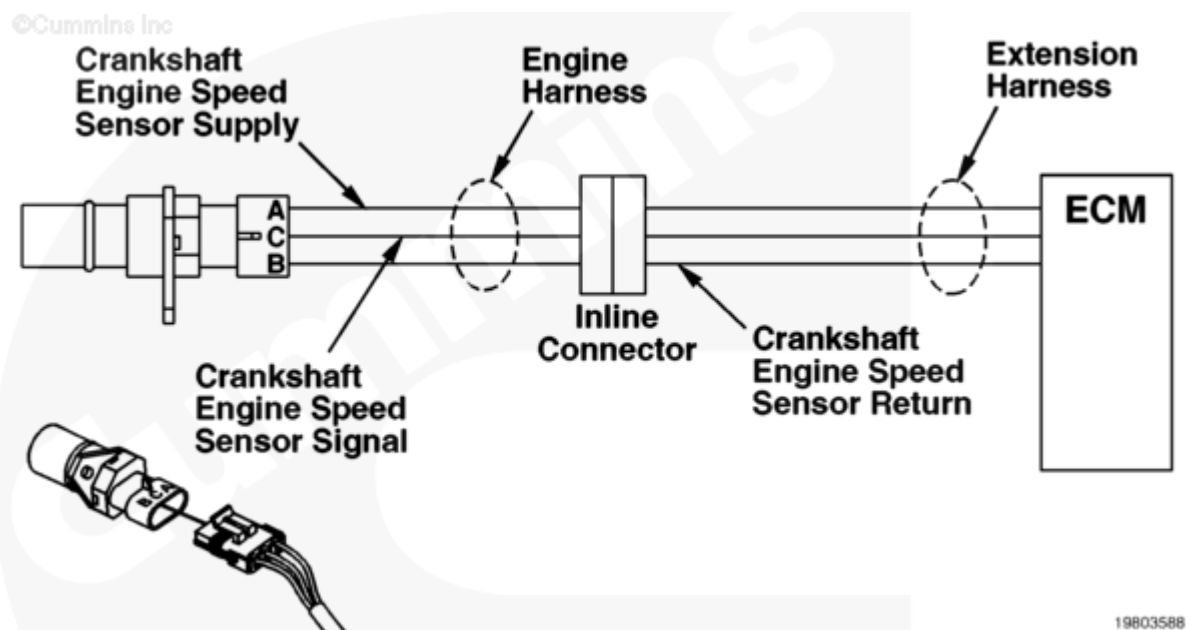

Crankshaft Engine Speed Sensor Circuit

Circuit Description

The crankshaft engine speed sensor provides engine speed and position information to the electronic control module (ECM). The sensor **must** be powered up by +5 VDC to operate. The sensor generates the signal by sensing the movement of target teeth machined into a tone wheel that is mounted to the crankshaft.

Component Location

Refer to the Engine Diagrams. 100-002 (</qs3/pubsys2/xml/en/procedures/01/01-100-002.html>) for the component location.

Shoptalk

Possible causes of this fault code include damaged crankshaft engine speed sensor, open or shorted circuit, or power supply voltage failure.

Refer to Troubleshooting Fault Code t05-689 (</qs3/pubsys2/xml/en/procedures/01/01-t05-689.html>)

Last Modified: 29-Jul-2010
