


Fault Code: 731

Engine Speed/Position - Mechanical Misalignment of Crankshaft and Camshaft

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 731 PID(P): SPN: FMI: Lamp: Warning SRT:	A mechanical misalignment has occurred between the camshaft and crankshaft. A sync error will occur.	No action is taken by the ECM. Possible loss of performance.

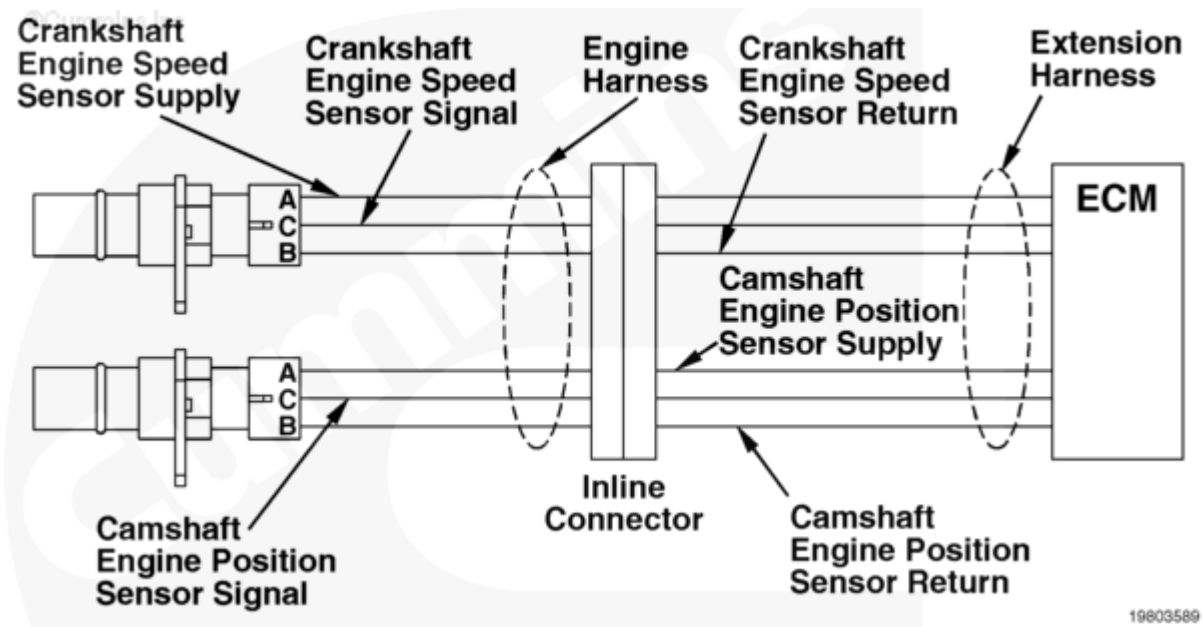

Engine Speed Sensor Circuit

Circuit Description

The engine speed sensor is a solid-state sensor that provides the engine speed signal to the electronic control module (ECM), through the engine harness.

Component Location

Refer to the Engine Diagrams. 100-002 (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

If the problem occurs **only** at a certain engine temperature, be sure to check the engine speed sensor circuit while the engine is at that particular temperature.

Refer to Troubleshooting Fault Code t05-731 (/qs3/pubsys2/xml/en/procedures/01/01-t05-731.html)

Last Modified: 29-Jul-2010
