


Fault Code: 778

Camshaft Engine Position Sensor Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 778 PID(P): SPN: FMI: Lamp: Shutdown SRT:	No engine speed signal detected from the camshaft engine position sensor.	Engine will shutdown.

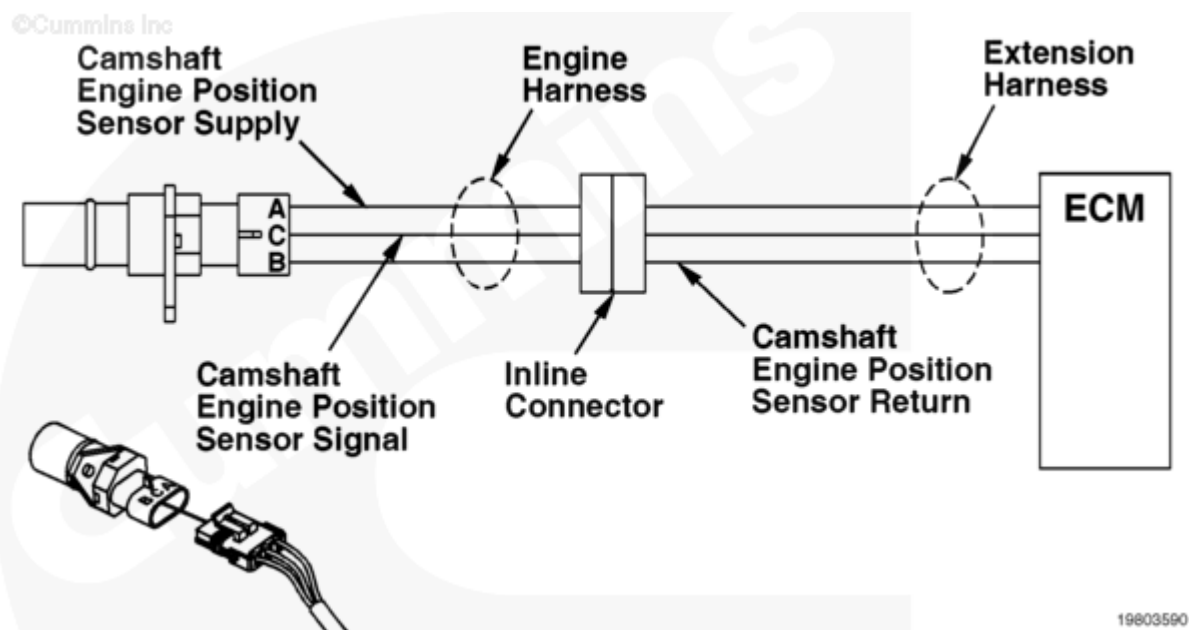

Camshaft Engine Position Sensor Circuit

Circuit Description

The camshaft engine position sensor provides engine speed and position information to the electronic control module (ECM). The sensor **must** be powered up by 5 VDC to operate. The sensor generates the signal from an extra lobe on the camshaft.

Component Location

Refer to the Engine Diagrams. 100-002 (/qs3/pubsys2/xml/en/procedures/01/01-100-002.html) for the component location.

Shoptalk

Possible causes of this fault code include damaged camshaft engine position sensor, open or shorted circuit, or power supply voltage failure.

Refer to Troubleshooting Fault Code t05-778 (/qs3/pubsys2/xml/en/procedures/01/01-t05-778.html)

Last Modified: 29-Jul-2010
