


Fault Code: 172

Rack Actuator - Mechanical System Not Responding Properly or Out of Adjustment

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 172 PID(P): S23 SPN: 638 FMI: 7 Lamp: Red SRT:	Rack actuator - mechanical system not responding properly or out of adjustment.	Engine shutdown.

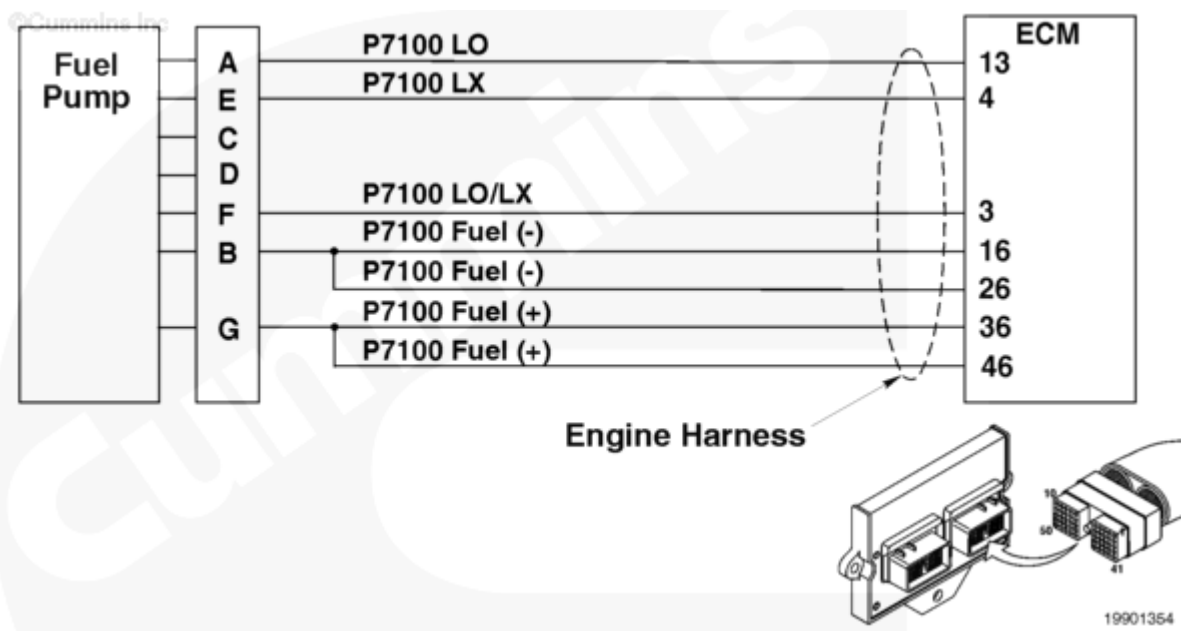

Rack Actuator Circuit

Circuit Description

The fuel control rack and solenoid determine the quantity of fuel metered to the engine.

Component Location

The fuel control rack and solenoid are integral parts of the P7100 fuel pump

Shoptalk

- Confirm the actuator connector is firmly in place.
- A defective fuel pump can cause Fault Code 172.

Refer to Troubleshooting Fault Code t05-172 (</qs3/pubsys2/xml/en/procedures/07/07-t05-172.html>)

Last Modified: 18-Dec-2012
