


Fault Code: 2185

Sensor Supply 4 Circuit - Voltage Above Normal or Shorted to High Source


 Printable Version

Overview


Codes	Reason	Effect
Fault Code: 2185 PID(P): SPN: 3512 FMI: 3 Lamp: Amber SRT:	High voltage detected at the sensor supply 4 circuit.	Loss of some sensor functionality.

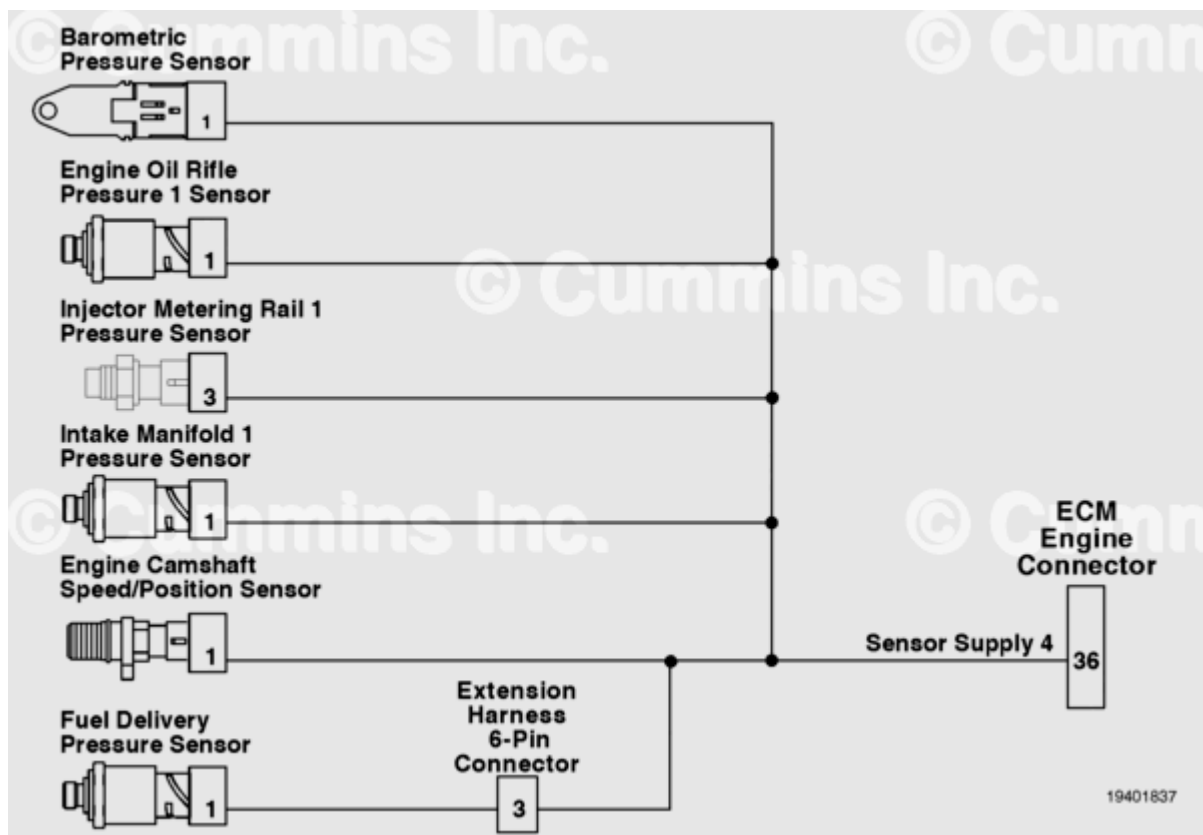

QSK19 CM2150 Industrial - Sensor Supply 4 Circuit

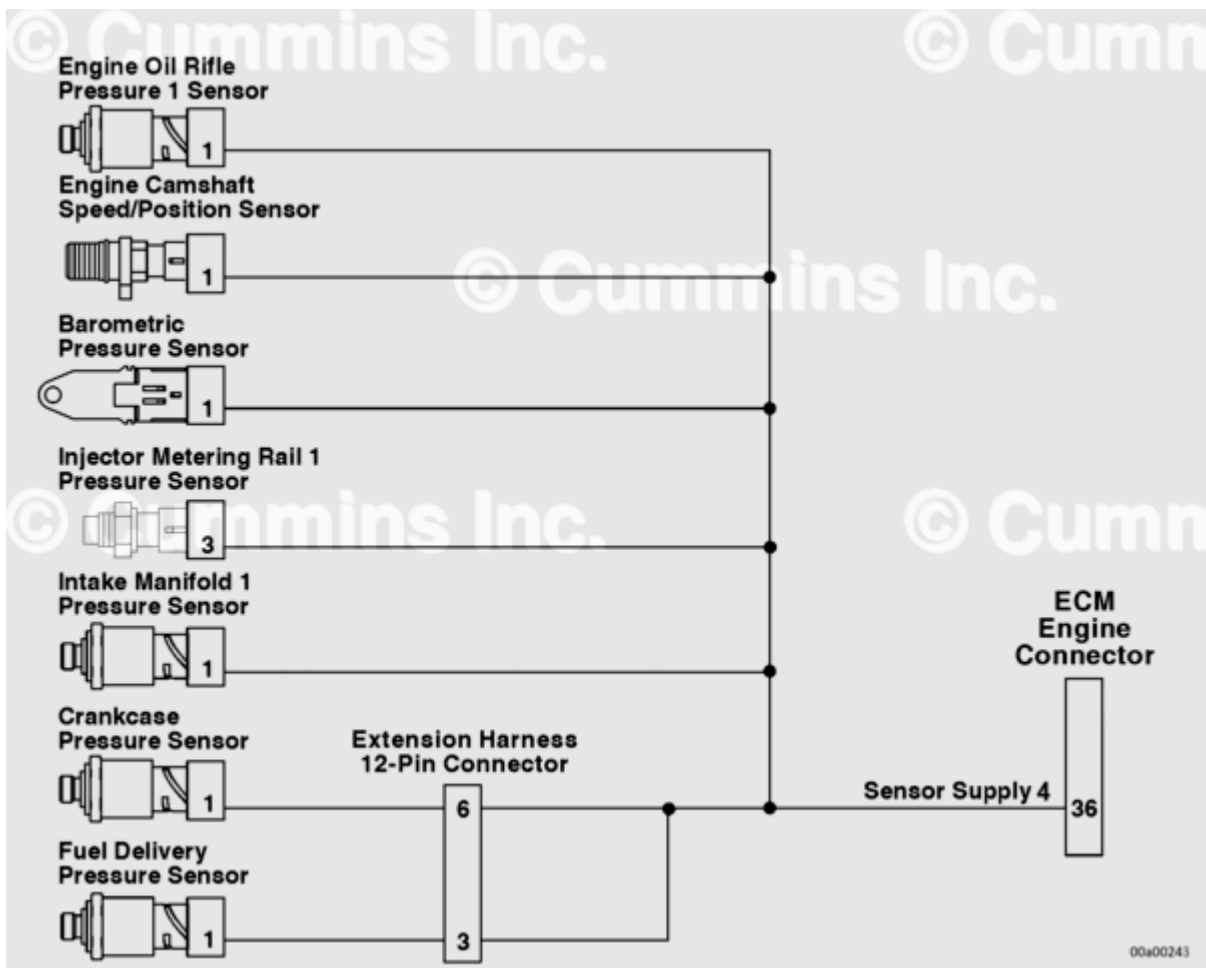

QSK19 CM2150 Marine - Sensor Supply 4 Circuit

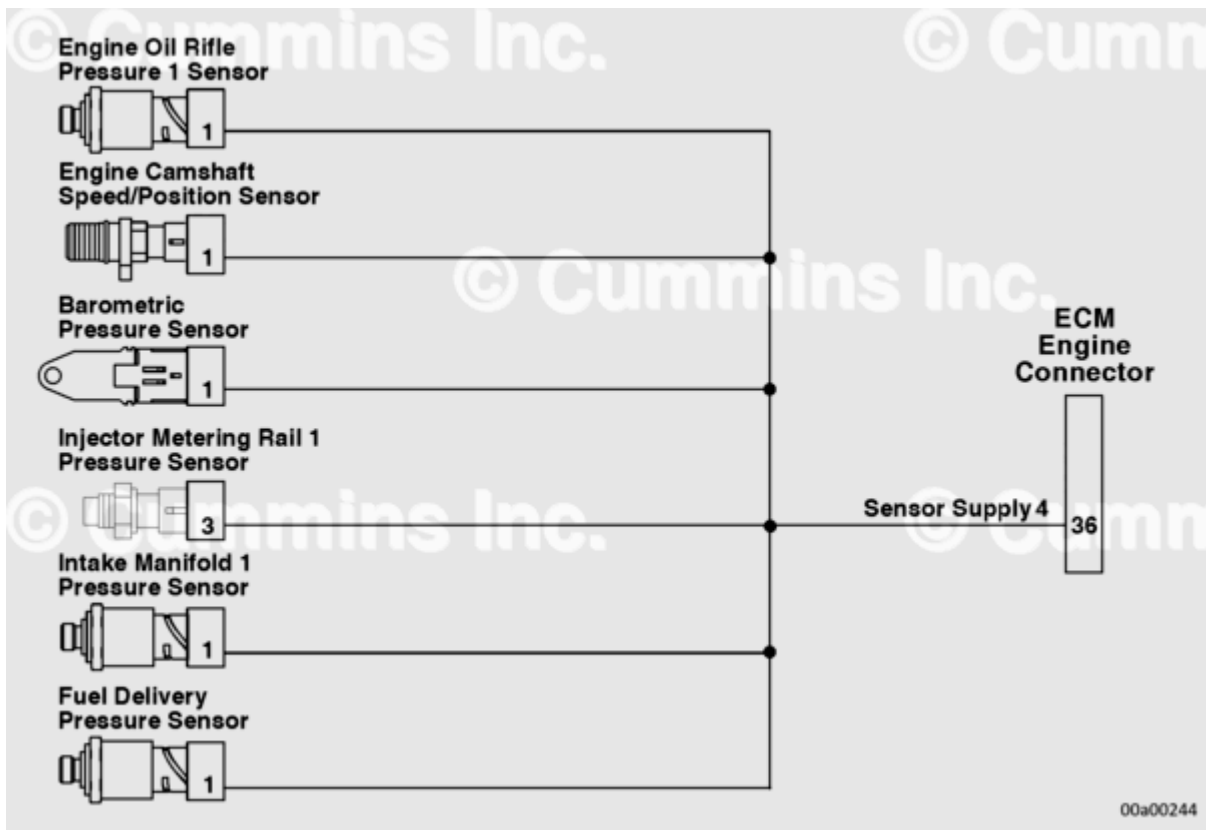

QSK19 CM2150 Power Generation - Sensor Supply 4 Circuit

Circuit Description

Sensor supply 4 of the engine control module (ECM) provides a 5 VDC supply to various sensors.

Component Location

The sensor supply 4 circuit of the engine control module (ECM) provides a 5 volt supply to various sensors. Refer to the wiring diagram for sensor supply identification.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code t05-2185. (</qs3/pubsys2/xml/en/procedures/123/123-t05-2185.html>)