


Fault Code: 227


Sensor Supply 2 Circuit - Voltage Above Normal or Shorted to High Source

 Printable Version


Overview

Codes	Reason	Effect
Fault Code: 227 PID(P): SPN: 3510 FMI: 3/3 Lamp: Amber SRT:	High voltage detected at sensor supply number 2 circuit.	Loss of some sensor functionality.

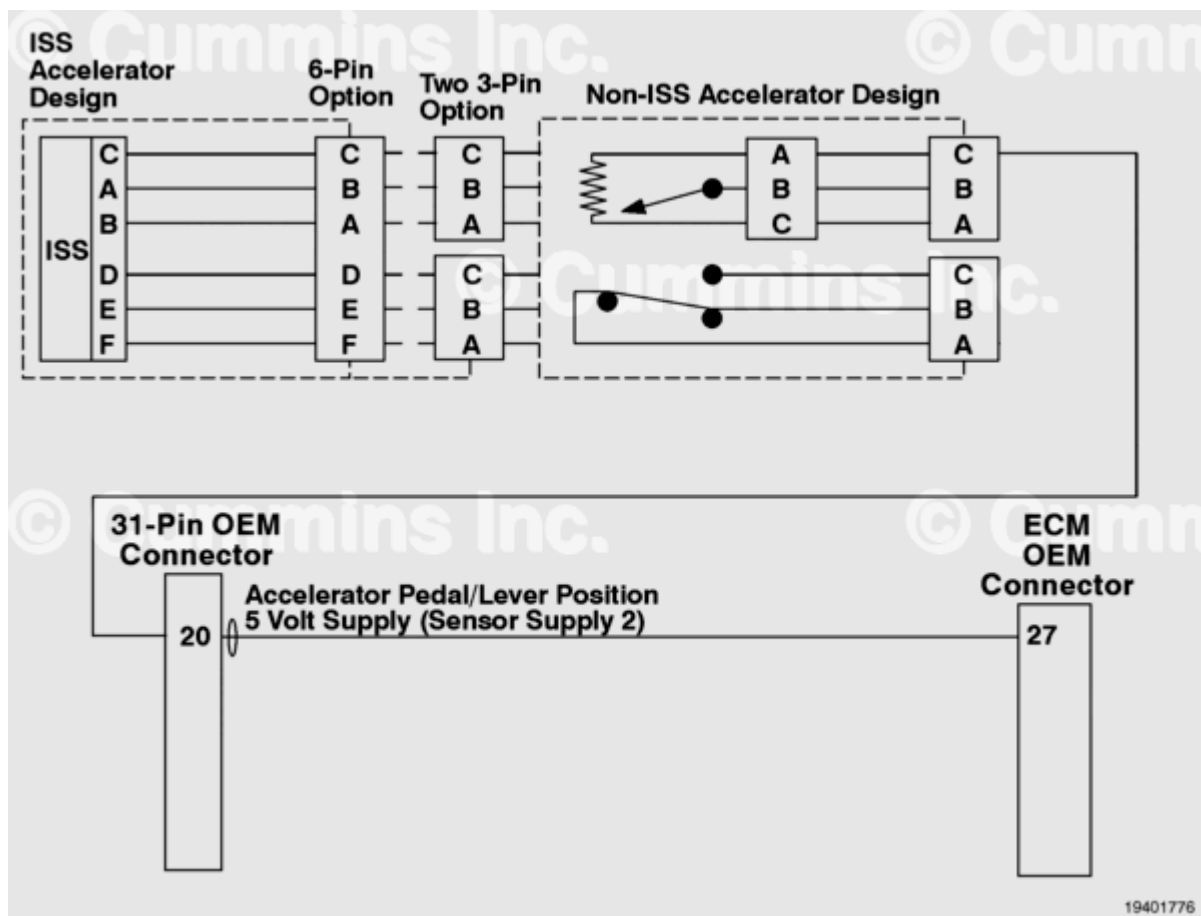


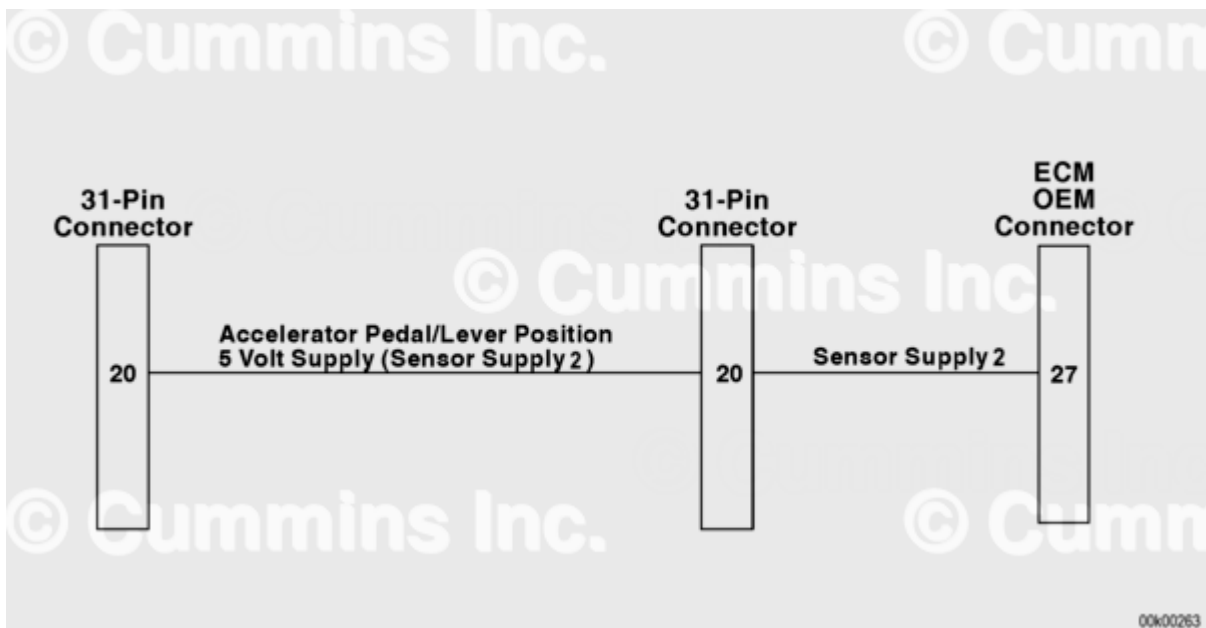

QSK19 CM2150 Marine/Marine Propulsion - Sensor Supply 2 Circuit

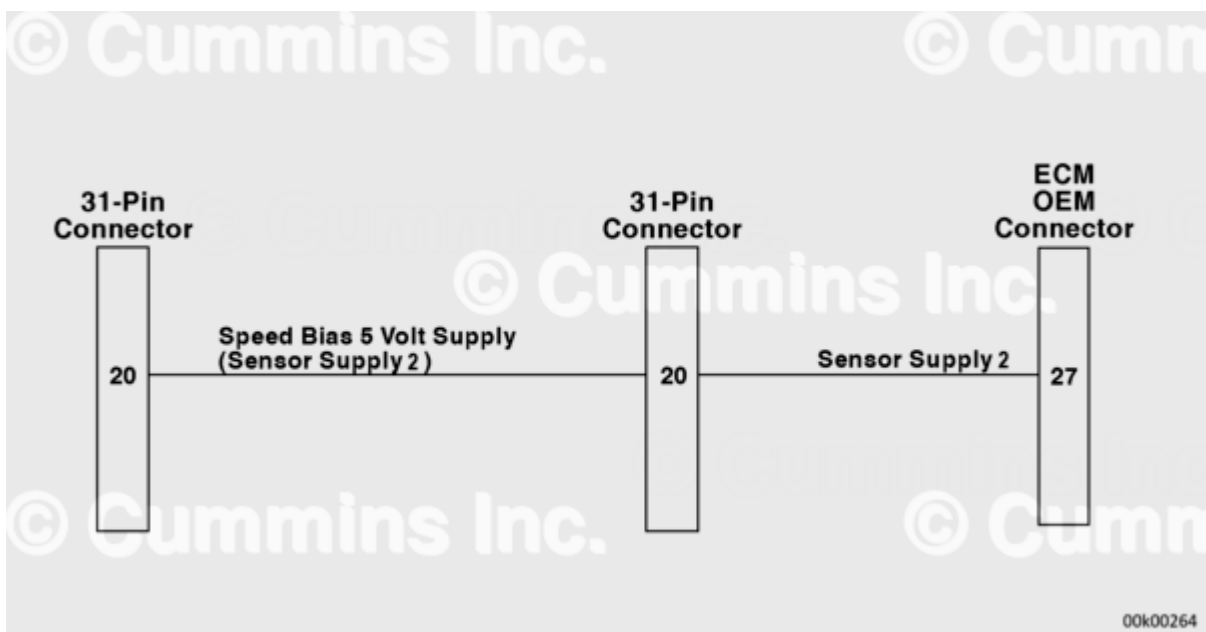

QSK19 CM2150 Marine/Marine Auxiliary - Sensor Supply 2 Circuit

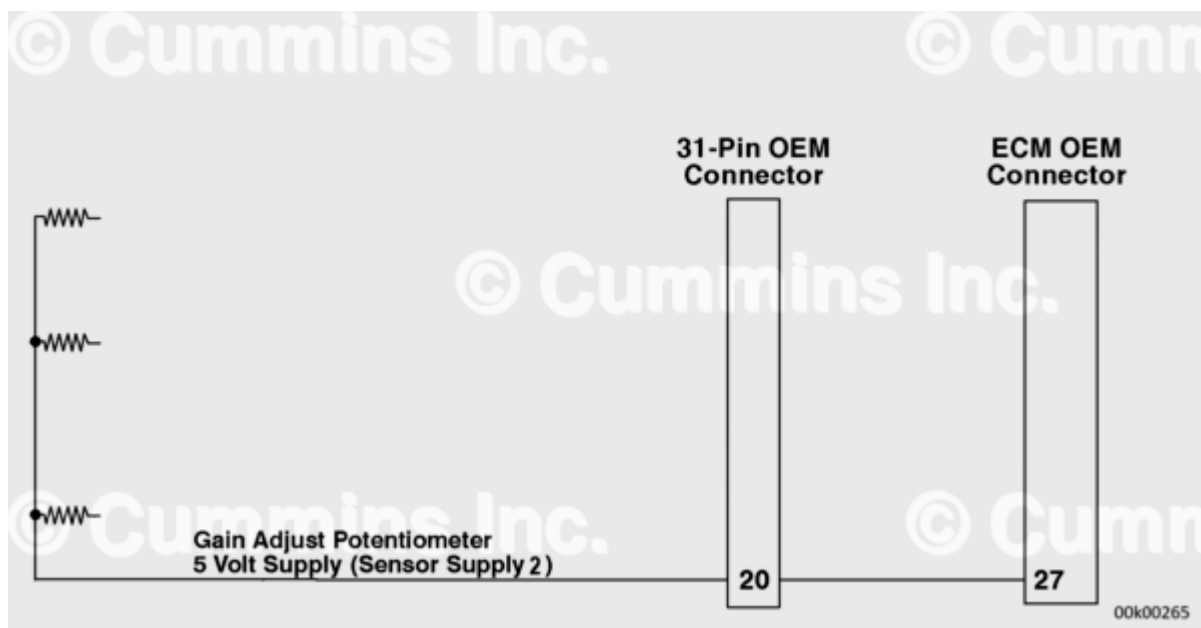

QSK19 CM2150 Power Generation - Sensor Supply 2 Circuit

Circuit Description

The sensor supply 2 circuit of the engine control module (ECM) provides a 5 volt supply to various sensors.

Component Location

The sensor supply 2 circuit of the engine control module (ECM) provides a 5 volt supply to various sensors. Refer to the wiring diagram for sensor supply identification.

Shoptalk

Possible causes of this fault code include:

- Malfunctioning or damaged OEM wiring harness.
- Malfunctioning or damaged engine wiring harness.

Refer to Troubleshooting Fault Code t05-227. (</qs3/pubsys2/xml/en/procedures/123/123-t05-227.html>)