

Fault Code: 2998


Engine Torque Limit Feature - Special Instructions

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 2998 PID(P): SPN: 1632 FMI: 14 Lamp: Amber SRT:	Engine Torque Limit Feature - Special Instructions. Engine overloaded.	Possible engine derate if enabled.

©Cummins Inc

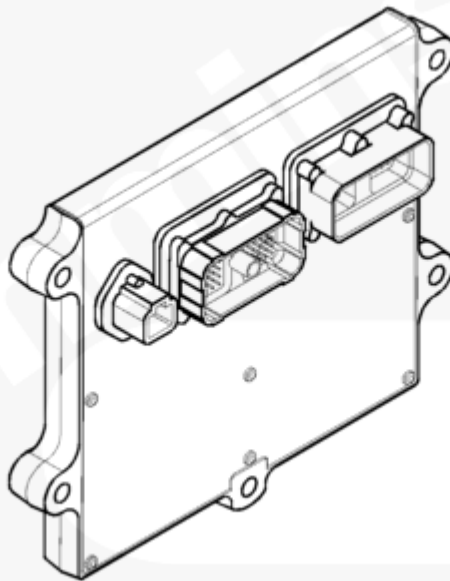

19c01042

ECM CM2150

Circuit Description

N/A

Component Location

N/A

Shoptalk

This fault code is designed to keep the engine from overloading.

The fault code is triggered when the engine speed fails to attain the commanded speed.

Potential causes of this fault code are:

- Low engine power
- High idle adjustment is too high
- Excessive hull fouling
- Incorrect transmission or propeller.

Refer to the OEM service manual for causes associated with excessive hull fouling and incorrect transmission or propeller, as these are external to engine.

Refer to Troubleshooting Fault Code 2998. (</qs3/pubsys2/xml/en/procedures/123/123-t05-2998.html>)

Last Modified: 20-Aug-2010
