



Technical Service Bulletin

Technical Service Bulletin: TSB101099

Released Date: 01-Dec-2010

Crankcase Blowby Measurement Procedure Update

Crankcase Blowby Measurement Procedure Update

Core Issue


This document announces the addition of specific instructions for measuring blowby on engines equipped with an external coalescent breather filter.

Confirmation

For engines equipped with external coalescent breather elements (ECMs CM871, CM876, CM2250, CM2150, and engines equipped with Enviroguard filters), connect the appropriate blowby service tool to the crankcase breather tube on the inlet side of the coalescent breather housing.



Make sure to install the service tool on the inlet side.

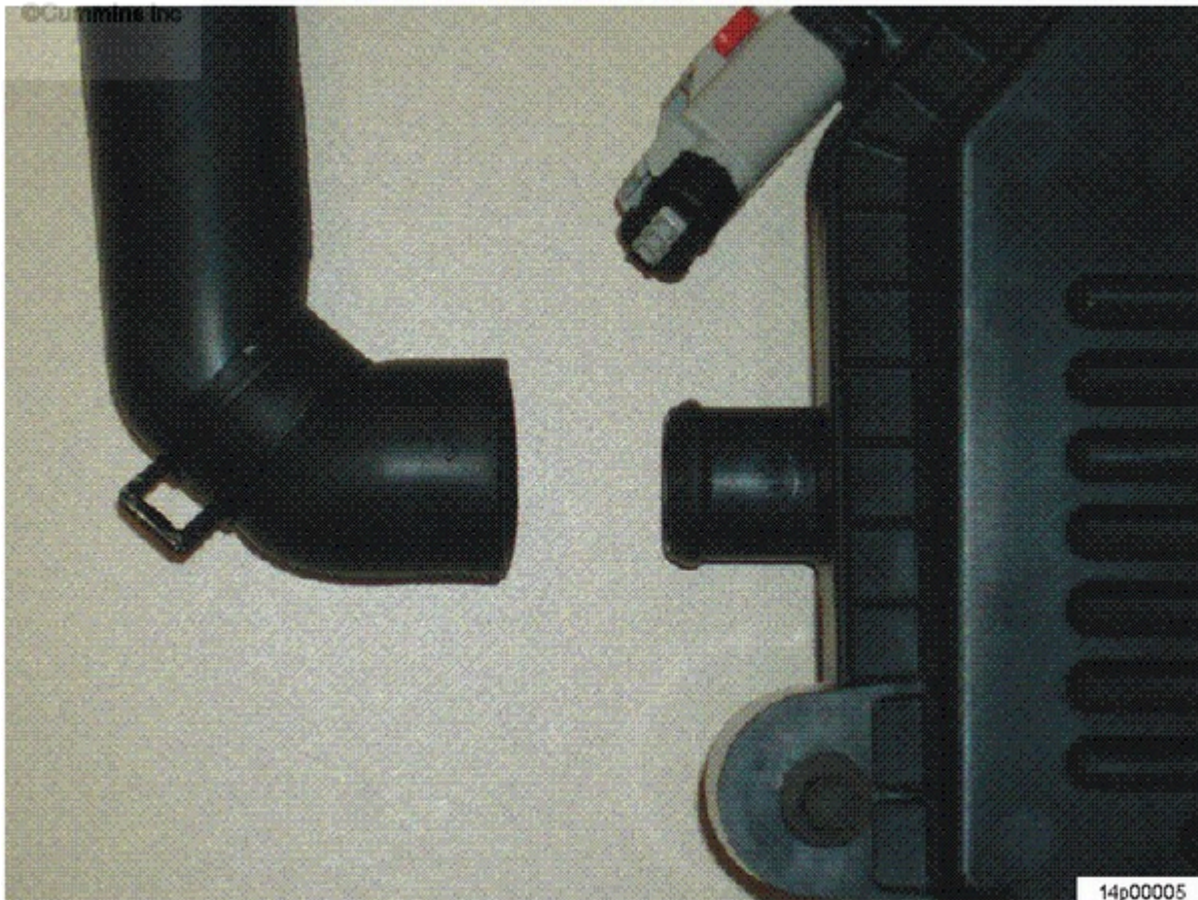

Resolution

By installing the blowby service tool into the inlet side crankcase breather tube, the potential for inaccurate blowby measurements caused by varying filter restrictions is eliminated.

Use the following procedure for measuring crankcase blowby in the following manuals:

- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr-mixab.html>) in Service Manual, ISX11.9 CM2250, Bulletin 2883445.
- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr.html>) in Service Manual, Signature™, ISX, and QSX15, Bulletin 3666239.
- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr.html>) in Service Manual, ISM, ISMe, and QSM11, Bulletin 3666322.
- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr-fiza.html>) in Service Manual, ISZ13 CM2150, Bulletin 4022133.
- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr-ismx.html>) in Service Manual, ISM CM876 SN, Bulletin 4022196.
- Refer to Procedure 014-010 in Section 14 (</qs3/pubsys2/xml/en/procedures/101/101-014-010-tr-mixar5.html>) in Service Manual, ISX15 CM2250, Bulletin 4022250.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Document History

Date	Details
2010-11-23	Module Created

Last Modified: 01-Dec-2010
