

Fault Code: 335


Internal Engine Control Module (ECM) Error

 Printable Version

Overview

Codes	Reason	Effect
Fault Code: 335 PID(P): 254 SPN: 629 FMI: 12 Lamp: None SRT: 00-680	Internal ECM error.	Data may be lost.

©Cummins Inc

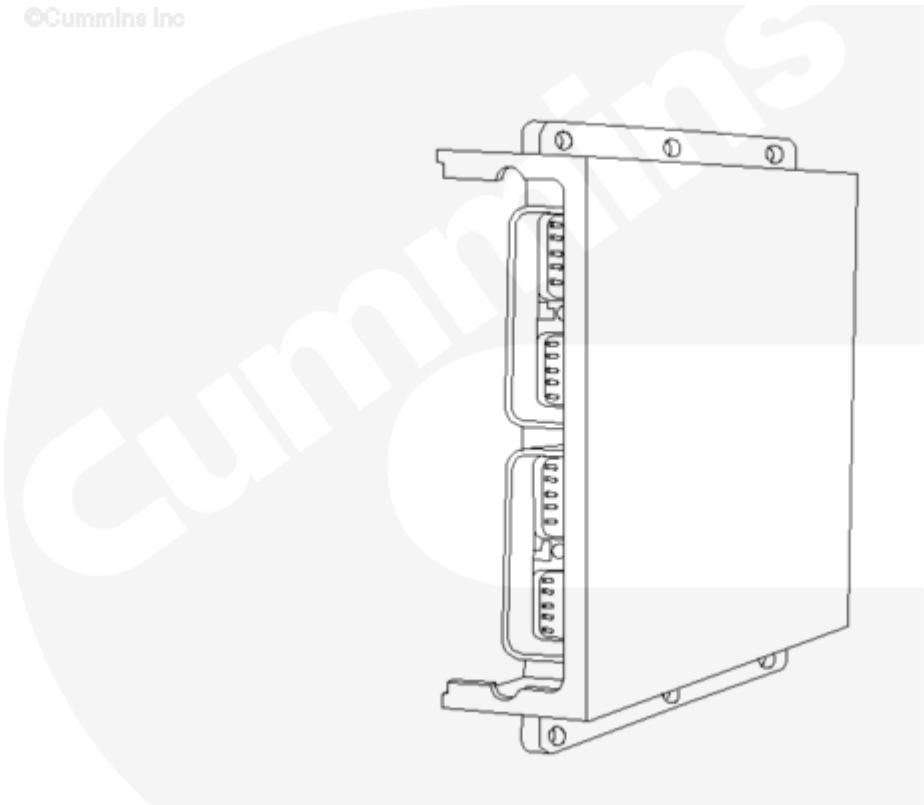

19800425

Electronic Control Module

Circuit Description

The CENSE™ ECM is a computer that is responsible for engine diagnostics.

Component Location

The CENSE™ ECM is installed on a plate that is located above the flywheel housing.

Shoptalk

This fault code indicates a possible internal ECM failure. The ECM can **not** be repaired in the field. Before replacing the ECM, use INSITE™ for CENSE™ to reset the fault codes and trend log using the CENSE™ data reset command under the Adjustments menu.

Refer to Troubleshooting Fault Code t05-335 (</qs3/pubsys2/xml/en/procedures/81/81-t05-335.html>)

Last Modified: 07-Jul-2015
