



Technical Service Bulletin: TSB230192

Released Date: 03-Oct-2023

New Front Gear Cover Gasket

New Front Gear Cover Gasket

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected

- QSK19 (All versions)

Description of Change

This document announces the new edge molded front gear cover gasket.

Reason for Change

The new front gear cover gasket addresses engine oil leakage malfunctions.

Service Instructions

- Front gear cover removal, cleaning, and inspection, see corresponding Service Manual. Reference Procedure 001-031 in Section 1.
- Do **not** use RTV or gasket adhesive during the installation of the front gear cover.
- The revised front gear cover gasket has four capscrew locations with a rubber retention feature to aid with assembly. See Figure 1.

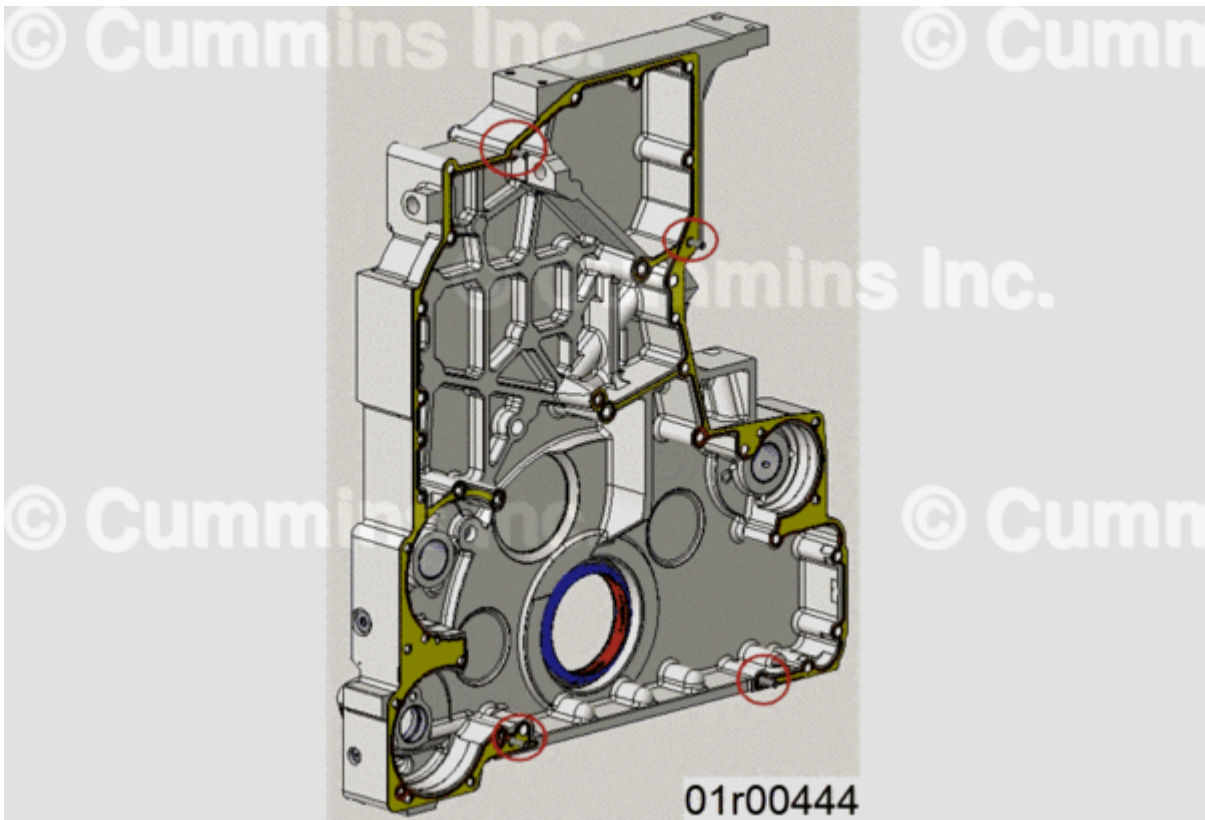


Figure 1, Front Gear Cover Gasket Rubber Retention Locations.

Service Parts Availability

Service parts are available. See Table 1 for part numbers.

Table 1, Service Parts				
Part Description	Existing Part Number	Obsolete	Superseded	New Part Number
Front Gear Cover Gasket	4080829	No	No	5593644

--	--	--	--	--

Document History

Date	Details
2023-9-28	Module Created