



Technical Service Bulletin

Technical Service Bulletin: tsb080053	Released Date: 30-Jul-2008
Non-Matching Connecting Rod and Rod Cap Serial Numbers	

Non-Matching Connecting Rod and Rod Cap Serial Numbers

Core Issue

This Early Field Notification informs the field of a parts alert issued for the QSK45 and QSK60 straight split connecting rods Part Number 3640518. This requires all stock in the field to be checked to make sure the connecting rod and connecting rod cap serial numbers are the same.

Note : As of April 2008, this issue has been resolved at the supplier.

Confirmation

All QSK45 and QSK60 connecting rods.


Non-matching connecting rod and connecting rod cap serial numbers have been found on new connecting rods being unpacked for assembly.

Connecting rod cap and connecting rod serial numbers should be identical. Connecting rod and connecting rod cap serial numbers can be found on the machined side of the big end of the connecting rod.

Quality of manufacturing process at supplier.

None.

Resolution

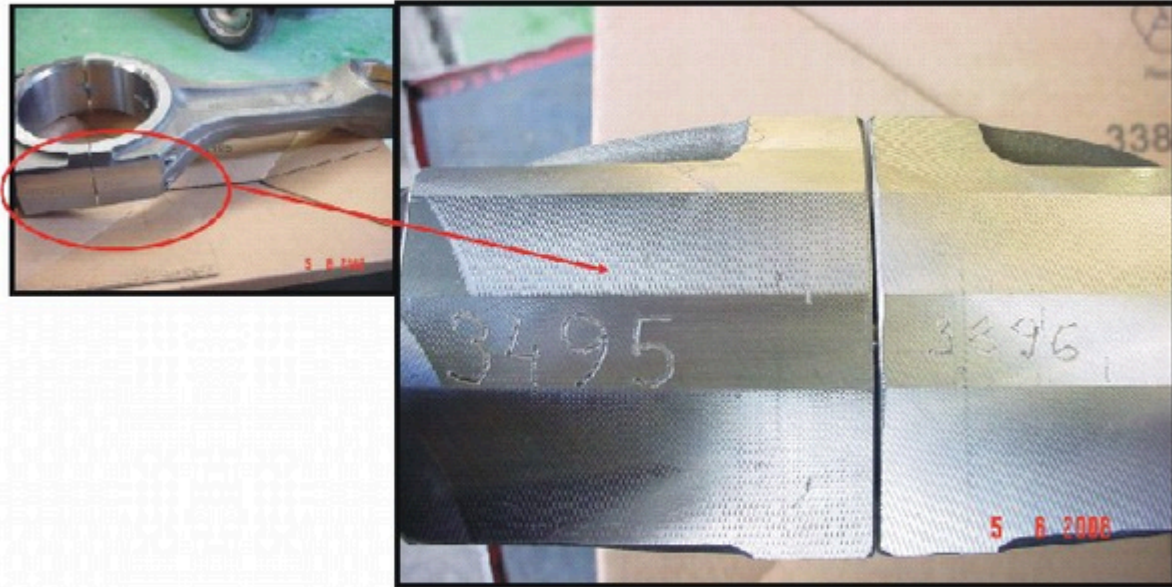

01600476

Any connecting rods found with non-matching serial numbers should **not** be used and returned to PDCs.

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Last Modified: 30-Jul-2008
