



Technical Service Bulletin

Technical Service Bulletin: tsb100137

Released Date: 11-Dec-2001

Turbocharger Bearing Coolant Plumbing

Turbocharger Bearing Coolant Plumbing

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin updates the following procedure in the Troubleshooting and Repair Manual, QSK45 and QSK60 Series Engines, Bulletin 3666261:

- High-Pressure Turbocharger (010-034).

This Technical Service Bulletin highlights the importance of the turbocharger bearing housing coolant supply and drain hoses being mounted diagonally opposed to each other to provide adequate coolant flow around the turbocharger bearing.

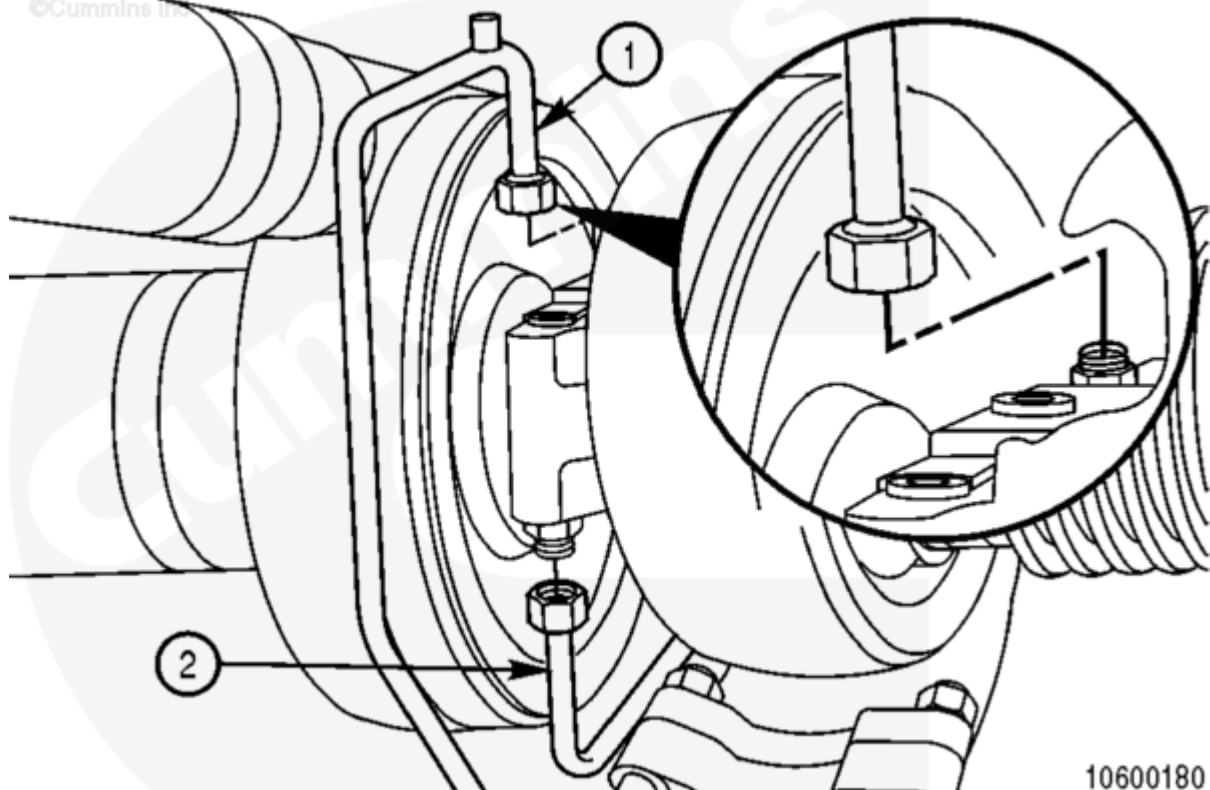


Fig. 1, Turbocharger Coolant Supply and Drain Hose Mounting (high pressure)

