



Technical Service Bulletin

Technical Service Bulletin: tsb100249

Released Date: 12-Jan-2004

New Thermostat Housing Gaskets


New Thermostat Housing Gaskets

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

This Technical Service Bulletin introduces a new thermostat housing gasket on QSK45/60 engines. The new gasket is of a metal core construction which replaces the fibre type gasket. The new gaskets are designed to provide improved sealing, thus reducing premature leaks at these joints.

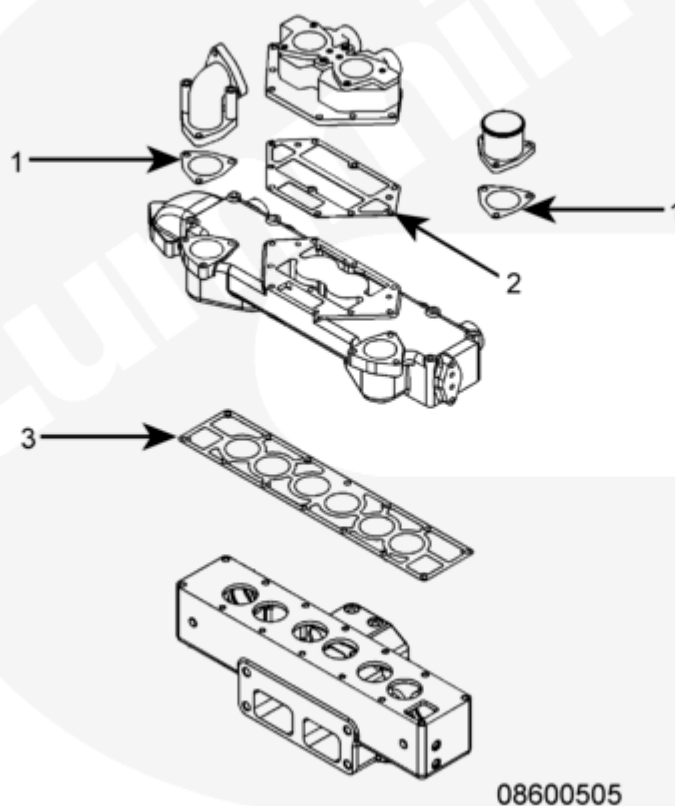

Part Number Changes

Item	Description	Old Part Number	New Part Number
1	Gasket, Connection	3089247	4101150
2	Gasket, Water Transfer Connection	3332081	4101149
3	Gasket, Thermostat Housing	3410688	4101148

Note : This is a product improvement, not subject to campaign.